


### SERVICE BULLETIN

Dometic GmbH, In der Steinwiese 16, D-57074 Siegen


RM 7211LSC, RM 7271, RM 7291, RM 7361, RM 7365, RM 7401, RM 7405, RM 7601,  
RM 7605, RM 7651, RM 7655

### Ignition Problems RM 7XX1 and RM 7XX5!

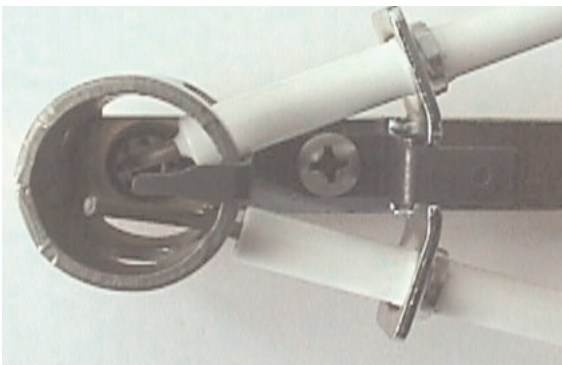

Due to production tolerances it might happen that the space between the ignition plug and the bottom of the burner housing is too small. Thus, a correct ignition is not always possible, as the spark might jump over to the burner housing.

Several deflagrations can be recognized, which after 20 seconds lead to a malfunction (yellow LED on the operating panel lights up). If this malfunction occurs, the holder can be bended to the back with the help of a pair of tongs. The space (A) should be between 7-9 mm.

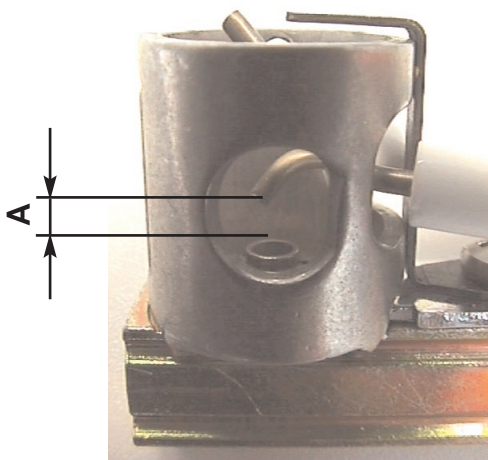

In case another gas malfunction is indicated, the burner control device has to be changed.

