

Dishwasher/ Nuernberg Factory DGN

DIVA Dishwasher

→ Error code indication: **i10** and possibly also **iF0** or **i30**.

Concerned appliances: All DIVA dishwashers, which were not subjected to an optimisation of the pressure control device connecting hose installation in the works.

If the connecting hose does not ascend from the drain pan in the direction of the pressure control device, but runs horizontally or slightly sags ("forming of a water pocket"), this may lead to the error codes mentioned above.

The error occurs sporadically, according to the way the hose has been installed (as the case may be a settling effect) and the forming of perspiration in the hose.

During production, the hose is fixed to a hole which is especially provided in the cross beam (2) using a cable tie.

Note: A constructive solution without cable tie will follow.

→ Service solution: when working on the dishwasher, the connecting hose has to be fixed at the drain hose using a cable tie by way of precaution.

The following figures show the problematic installation (1) (sagging) as well as a serial solution (2) and the solution for the service (3).

