

**Cooking appliances**

**599 528 416 EN**

---

**Scorch locations with plug connections**

**Problem:** Charred respectively burnt plugs/pin terminals with electronics and switches.

**Reason:** Due to faulty crimpings or expanded plugs arise scorch locations within the area of the line connection. When you leave the former plug in case of a service, e.g. when substituting a defective electronic, this fault will repeat again in most cases.

**Problem removal:** **In case of scorch and fire locations respectively within the area of plug connections you always have to replace the affected connectors.**

That means, cut the plug at the corresponding braid (cable) and connect a new plug. Leave the former plug at the pin terminal and return it, if possible unchanged and packed in good condition, together with the defective spare part to the works in Rothenburg to the following address

AEG Hausgeraete GmbH  
Abt.: DGT-QZ zu Hd. H. Leis  
Bodelschwingstr. 1  
DE-91541 Rothenburg ob der Tauber

The required pliers and the plug-in sleeves can be obtained as spare parts.

<b>SP No.</b>	<b>Description</b>
<b>899 298 001 194/4</b>	<b>AMP pliers</b>
<b>407 139812/9</b>	<b>Plug-in sleeve 4.8x0.8 St. nickelized 0.5-1.5mm<sup>2</sup></b>
<b>899 298 001 301/5</b>	<b>Plug-in sleeve 6.3x0.8 St. nickelized 0.3-0.8mm<sup>2</sup></b>
<b>899 298 001 302/3</b>	<b>Plug-in sleeve 6.3x0.8 St. nickelized 1.2-2.5mm<sup>2</sup></b>