

SERVICE BULLETIN

Dometic GmbH, In der Steinwiese 16, D-57074 Siegen


RM 7211/71/75/91/95, RM 7361/65/71/91/95, RM 7401/05, RM 7501/41/45/51/55, RM 7601/05/51/55, RM 7801/05/51/55

Additional Ground connection for MES and AES III


An inadequate ground connection in the leisure vehicle can cause a high current flow via the electronics (contact X105) of the fridge to the grounding at the gas line.

To avoid this and in order to protect the electronics, we created new connection cables with an additional grounding to the housing.

This cables have to be changed in case of repair, due to above mentioned error.

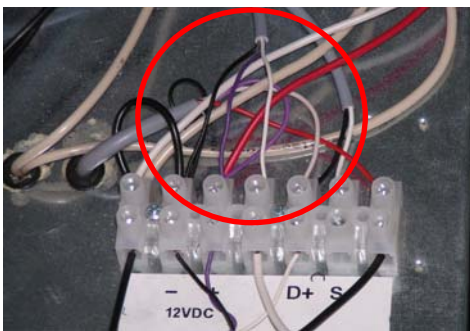


Wiring of connection cable, factory-made

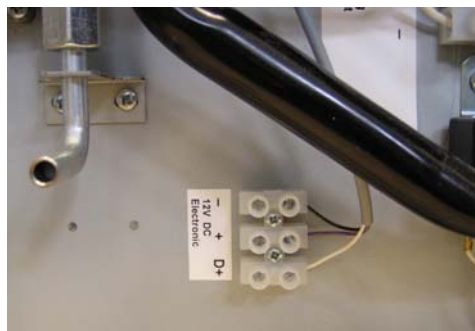

Connection cable, 241 2796-03/5



Connection cable, 241 2796-91/0

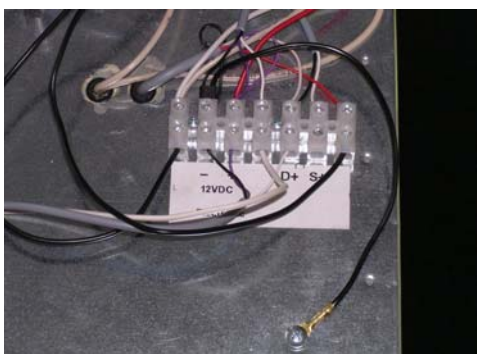

Wiring of connection cable, Service

Fix additional grounding onto fridge housing with a screw.

