

Publication no.	599 7088-29 EN	Version	1
Date	2008-05-27	created by	MBA
Model	RM 7xxx / RM 8xxx		
Subject	Electrical doorlock trouble shooting		

1. Trouble shooting electrical doorlock

A failure of the electrical doorlock at RM 7xxx and RM 8xxx refrigerators could occur. The door does not open after release of the electrical doorlock.

In this case proceed as follows to open the door :

- 2 persons are needed.
- Person 1 starts the engine (to activate the electrical doorlock).
- Person 2 releases the door by pressing the door towards the fridge compartment.
- Person 1 stops the engine (to deactivate the electrical doorlock).
- Person 2 is now able to open the door.

The reason of that failure is a deadadjustment of the doorlatch.

2. Adjustment of the doorlatch

Adjust the doorlock if it does not lock correctly.

- Remove cover of the doorlatch

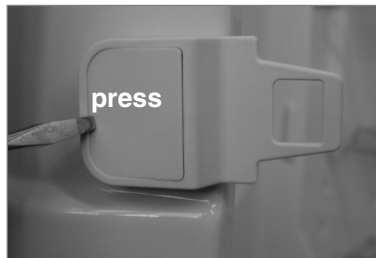


Fig. 1

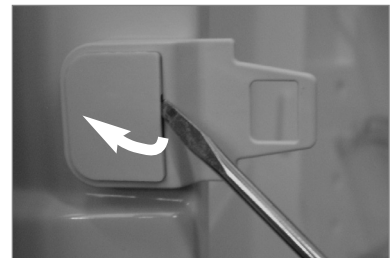


Fig. 2

- Adjust doorlatch (move forward)

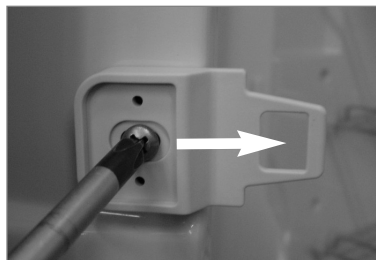


Fig. 3