

Service-Bulletin

Washing machines


599 709 103 EN

Toploader

1. Noises with drain pump (ASKOLL)

Concerned are all appliances of the series CLAUDIA.

Distinguishing mark: Water inlet compartment in the upper part and fluff filter flap in the front panel.

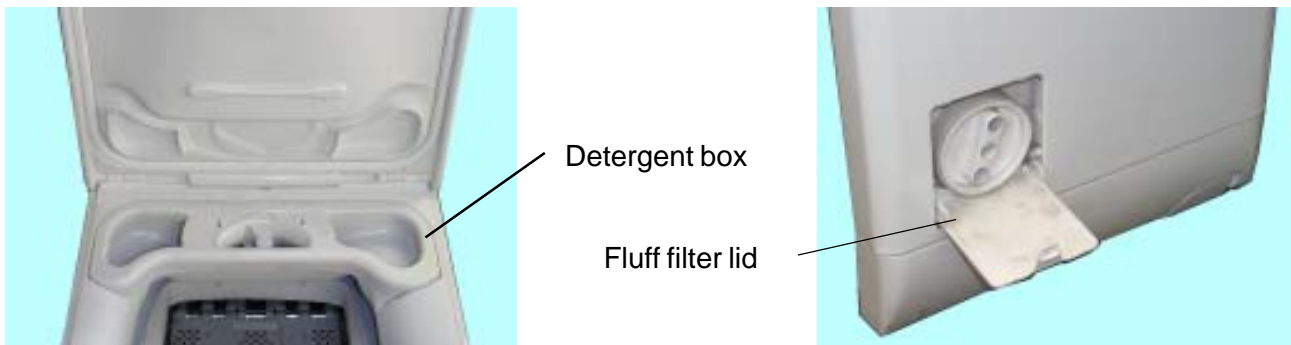

- Cause:
- a) Vibration noise with the pump housing
 - b) Operation noise within the bearing area.

- Measure:
- a) Secure the pump casing with silicone, or clamp a foam part below the pump housing.
 - b) Replace the drain pump.
 - Ref. 146057320/5 drain pump PLASET
 - Ref. 407143602/8 drain pump PLASET with silicone

Since week 21/07 (calendar week 44/07 for Germany and Italy) the factory builds in a drain pump from PLASET.