

Dometic GmbH, In der Steinwiese 16, D-57074 Siegen

B1600plus, B2200

Fan works with maximum speed

At airconditioners B1600plus and B2200, which were built between the 07/01/2010 and the 01/03/2010, it could happen that the fan works with maximum speed and could not be settled.

The reason of this failure could be caused by the electronics, which has to be exchanged in this case.



“DATA 20/02/10” is the production date. Electronics produced between 09/12/09 and 20/02/10 could be involved.



The lettering on the relay “JQX-115F-012-1HS3**B**” shows the wrong relay.

The correct relays show one of the following lettering:

HF115F 012-1HS3

JQX-115F 012-1HS3 (xxx)- without letter “**B**”

HF-115F 012-1HS3B