
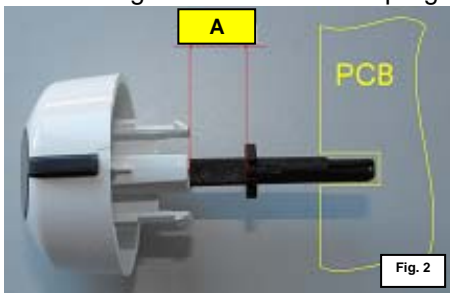


**Inability to select programmes on SMART tumble dryers**

**DESCRIPTION:**

On ventilated tumble dryers featuring SMART styling, which are easily recognised by the typical programme selector knob on the control panel (fig.1), it has been noticed that the pin connecting the knob to the programme selector on the circuit board detaches itself, thereby not allowing the user to select a programme.

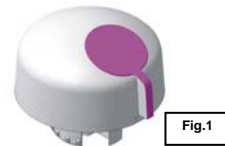


The problem is caused by the excessive distance (A fig 2) between the knob and the retainer ring of the selector pin.

**MODELS CONCERNED:**

The modification concerns all ventilated tumble dryers featuring SMART styling with serial numbers before 019xxxxxx.

**SOLUTION:**

To solve this problem, a bush should be inserted onto the pin connecting the knob to the programme selector, on all appliances - whether affected by this problem or not - as shown in the figure, in order to prevent the pin from becoming detached from the selector on the board.

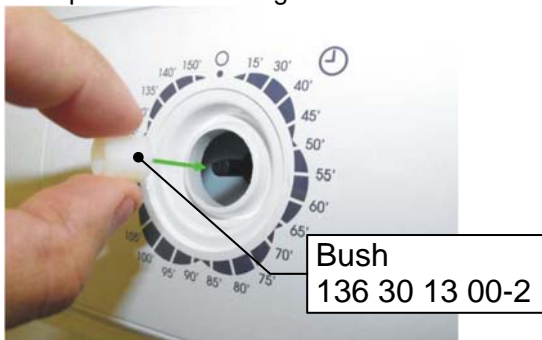

If it is too difficult to remove the knob, it is advisable not to insist in order to avoid damaging the knob holding clips. Instead, remove the entire board support as specified in the service manual.

**SPARE PART NO.**

Bush PN 136 30 13 00-2