


SERVICE BULLETIN DISHWASHERS

ALARM i30 IN DISHWASHERS WITH A THIRD SPRAYING ARM

DESCRIPTION:

On certain "RealLife/ProClean" Dishwashers with the third spraying arm (1), sometimes a few drops of water have managed to get into the steam vent tube of the drying duct (2) and thus get into the tray at the bottom.


This may occur in the event of an accidental blockage - for instance due to a teaspoon that has not been placed in the top cutlery basket (3) properly - of the third spraying arm with the jet of water directed towards the steam vent tube of the drying duct.

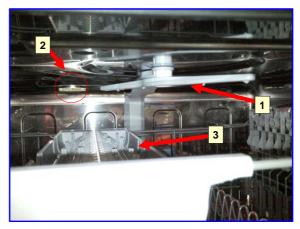

The water that may build up during subsequent cycles could trip the anti-flood device and cause the appliance to break down with the i30 alarm stored.

SOLUTION:

From serial number 035xxxxx, the drying duct has been modified. A plastic wall (4) has been added inside the component to protect the outlet hole.

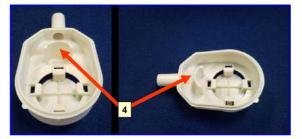

So even in the event of an accidental blockage of the third spraying arm, the water can no longer enter the steam vent tube.

SPARE PART NOS:

The new spare part no. 117145821/7 was created for this purpose. It replaces and is fully interchangeable with previous spare part no. 117145820/9. If a request for the old part no. arrives (the existing spare parts lists will not be updated), only the new, modified drying duct will be supplied.

REVISION:

Revision	Date	Description
00	09/2010	Document creation

EN	Publication Number	599 73 91-13	Rev. 00	09/2010	PR
----	--------------------	--------------	---------	---------	----