

**TEMPERATURE FLUCTUATION**

**DESCRIPTION:**

In relation to the equipment listed in Table A, (385 Cooler Dy) excluding those with the ERF2001 circuit board, temperature fluctuation and warm refrigerator phenomena can occur.

**MODELS AFFECTED**

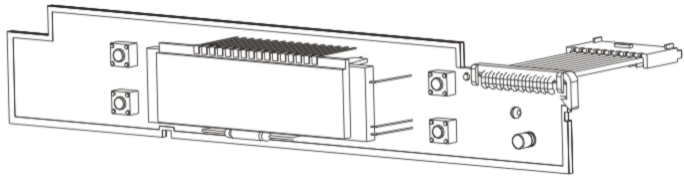
**TAB A:**

PNC_ELC	Model
923 879 xxx_xx	385 cooler Dy

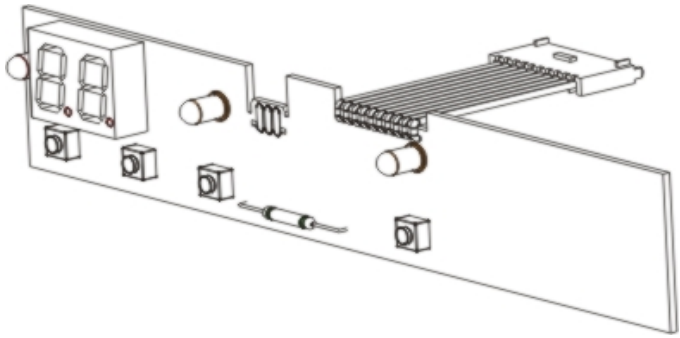
**SOLUTION:**

To resolve the problem, the temperature setting on the board has been reduced by 1.5°C. To do this for equipment that is already on the market, it is necessary to replace the circuit board as reported in the table below.

**ENV06**

Board with problems	Board to be ordered	
242531334-9	242531390-1	
242531370-3		
242531383-6		

**AEG**

Board with problems	Board to be ordered	
242515820-7	242515838-9	
242515833-0		
242515837-1		