

**HEATER CHANGE IN VENTED TUMBLE DRYERS.****DESCRIPTION:**

The TH1 modification in heaters 1257533xx implies the change of working temperature from 92°C to 75°C. Because of this, increased sensitivity to filter dirtying may be observed.

The dirty filter may cause disrupted heater work during drying cycle combined with dryer's lower overall working temperature. This causes significant decrease in drying efficiency.

At the end of drying cycle alert 'E62' will be displayed.

**SOLUTION:**

To improve drying efficiency it is necessary to clean the filter and turn the dryer off for several minutes in order to cool down the heater below reset temperature (~67°C).

**SPARE PARTS INVOLVED:**

<b>Part Detail</b>	<b>ANC</b>
Heater	125 7533 06
Heater	125 7533 16
Heater	125 7533 26
Heater	125 7533 36
Heater	125 7533 46

**MODELS INVOLVED:**

<b>PNC</b>	<b>Model name</b>
91609309904	987297_00
91609334704	ZTB261
91609335504	EDE47130W
91609336303	ZTB261
91609526902	T75170AV
91609335002	ZTA240
91609335602	EDE37100W
91609336401	EDE37100W
91609521304	ZTB276
91609521404	ZTB271
91609521804	EDE77550W
91609521904	EDE67550W
91609525201	EDE77550W
91609525301	T65178AV
91609525401	T65179AV
91609525501	T75175AV
91609525601	T75170AV
91609525801	T75175AV
91609526001	T75175AV
91609526101	T65179AV
91609526201	T65170AV
91609526501	T65170AV
91609526601	T65170AV
91609326701	ZDE26610W
91609336601	ZDE47200W
91609524002	EDE77550W
91609520202	T35850
91609526701	ZDE67560W

**REVISIONS:**

<b>Revision</b>	<b>Date</b>	<b>Description</b>	<b>Author</b>	<b>Approved by - on</b>
00	10/2011	Document Creation	KL	