

### DOOR COVER BOTTOM WITH ADD GASKET TO EVOID STEAM INSIDE THE DOOR ON APOLLO

This service instruction for assembling the door cover bottom with the additional gasket (spare part kit **561 83 15-26/0**), is valid for all Apollo Steamer from serial start **(2012)** until **3 10 20224 (2013)**.


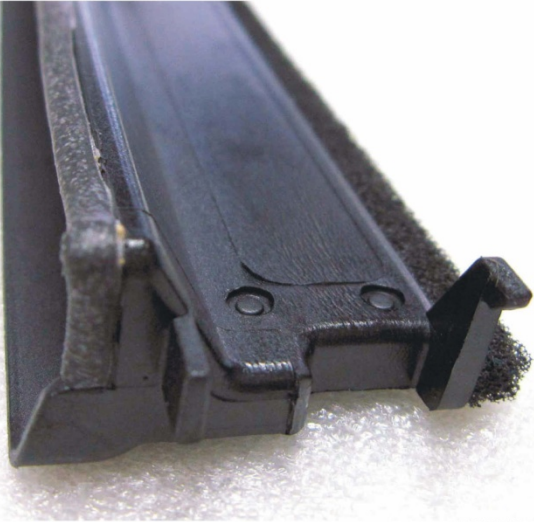
**PROBLEM :** Steam inside the door (between the glasses).

**REASON :** On the bottom part, the door is not tight.

**CAUSE :** Gap between inner glass door and door cover bottom.

**PROCEDURE :**

1. Unhinge the door and open according guideline.
2. Change original door cover bottom against the new one with the additional gasket (see Fig. 1 and 2). Pay attention not to displace the gasket.
3. Carefully reassemble the door, mount the door in the oven and proceed with the functional test.

Door cover bottom, original state (Code <b>387 92 24-21/4</b> )	Door cover bottom, modified with additional gasket (Code <b>561 83 15-26/0</b> )
 <p style="text-align: center;">HDC06117.JPG</p> <p>Fig. 1</p>	 <p style="text-align: center;">HDC06118.JPG</p> <p>Fig. 2</p>

#### REVISION:

Revision	Date	Description	Author	Approved by - on
00	08/2013	Document Creation	[TEAM] – [GJA] (FV)	