

WATER DISSIPATION TRAY OVERFLOWS NOT TO ADDITIONAL DRIP TRAY.

DESCRIPTION:

Water leaks to wrong side of evaporation tray – not to additional drip tray. It is caused by not correct positioning of compressor evaporation tray.

SOLUTION:


To correct compressor evaporation tray follow below instructions:



1. Remove compressor evaporation tray.



2. Place adhesive sponge in indicated area.

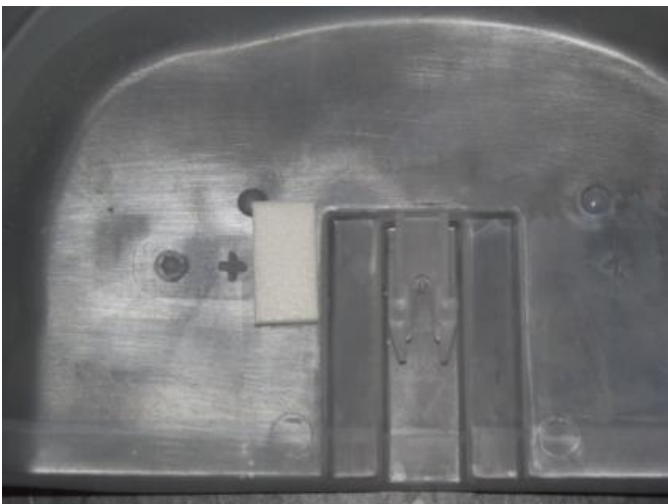

3. Correct placement of adhesive sponge.



4. Put the evaporation tray back on compressor. Corner above additional drip tray should be slightly lower than other ones.



5. Place drain tube back in evaporation tray. **Must be positioned to right side.**



6. Correct placement of evaporation tray and drain tube.

SPARE PART NUMBER:

Spare part code	Description	Quantity
2240202313	Adhesive sponge	1

MODELS INVOLVED:

PNC	MODEL	BRAND
925052250	ERF4161AOW	Electrolux
925052251	ERF4161AOX	Electrolux
925052252	S54000KMW0	AEG
925052253	S54000KMX0	AEG
925052254	S84000KMW0	AEG
925052255	S84000KMX0	AEG
925052256	S54000KMW0	AEG
925052257	S54000KMX0	AEG
925052258	JLLFW1815	John Lewis
925052263	S74000KMX0	AEG

REVISION:

Revision	Date	Description	Author	Approved by - on
00	07/2013	Document Creation	Krzysztof Łazowski	Sándor Kórik – 17.07.2013