



F325 error on Apollo ovens with SmartBoard

DESCRIPTION:

In case of Apollo ovens with SmartBoard 3876737010 there are many cases of error F325. This appears also after new repairs. The most common reason is lack of calibration of the SmartBoard.

SOLUTION:

Each time a SmartBoard or user interface is replaced preform the calibration procedure.

Calibration is required to achieve desired results with 'automatic cooking' functions. The appliance has to be adapted to suit the surroundings, which takes about 4 hours.

Please observe the following instructions before starting calibration:

- The calibration must take place at a **room temperature below 35 degrees Celsius**.
- Install the appliance in its **final location for calibration**.
- Make final connection of appliance to the mains supply for the calibration.
- The appliance must always be recalibrated in case of changes to location, mains supply or one of the other points mentioned in order to attain best results with 'automatic cooking' function.
- The appliance has to cool down before attempting calibration.

After calibration the appliance is ready for use as soon as it has cooled down.

Calibration:

1. Activate the appliance.
2. Select from the menu: Basic Settings and press OK.
3. Select function: Calibration and press OK.

Information:

When you calibrate for the first time, to start the procedure you can set the category from the control panel or select the function from the main menu: Auto Cooking.

MODELS INVOLVED:

All Apollo ovens with SmartBoard 3876737010.

REVISION:

Revision	Date	Description	Author	Approved by - on
00	10/2015	Document Creation	Marcin Kobiałka	Josef Leis 2015-10-07