

**RM 84xx, RM 85xx, RMSL 85xx, RML 85xx, RMF 85xx, RMD 85xx
RMDT 85xx with MES4 or AES4 electronic,
RML 933x, RML 943x, RMLT 943x**


Dometic GmbH
In der Steinwiese 16
D-57074 Siegen
www.dometic.com

Problems of condensation at the doorlock

Caused by condensation water the lighting platine can be short-circuited. Under this circumstance, the lighting does not switch off, but the electronic device displays the warning "Open fridge door". This reaction is depending on the fridge model. A short-term solution could be a dehumidification of the platine (please see pictures below). Finally the lighting platine must be exchanged.



Contacts of the old lighting platine

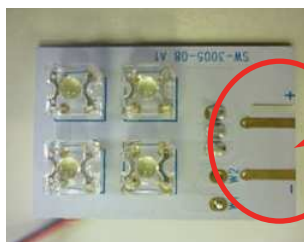

Contacts of the new lighting platine

Short-term solution

Dehumidification of the lighting platine



Long-term solution

Change of the complete lighting unit

The correct sparepart numbers are listed on Procorner.

Below please find a list of the different lighting units.

289 0371-03/8, left hand hinge, RM 84xx, RM 85xx, RMD/T/M 85xx, RML 855x, RMSL 850x, RMF 850x mit MES4 or AES4

289 0371-13/7, right hand hinge, RM 84xx, RM 85xx, RMD/T/M 85xx, RML 855x, RMSL 850x, RMF 850x with MES4 or AES4

295 1799-60/6, RML 933x

292 3160-56/4, right, RML 943x, RMLT 943x

292 3160-57/2, left, RML 943x, RMLT 943x