




Faulty cast iron pan support rubbers

DESCRIPTION:

In gas hobs, rubber feet glued to the cast iron pan supports deteriorate and become loose. In order to eliminate the problem, new version of pan supports and rubber feet have been created. As a result, new type of pan supports have threaded larger holes to facilitate the insertion of the rubber feet without any glue.

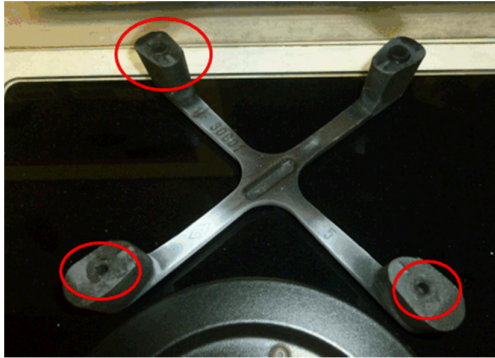



Mounting place of rubber feet





Deteriorated old type of rubber feet

SOLUTION:

In case of pan support damage or rubber feet damage, it is possible to order new version of pan supports. New pan supports are compatible with old versions and additionally equipped with new high performance rubber feet.

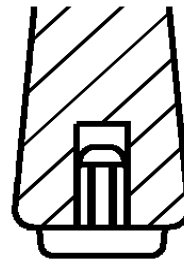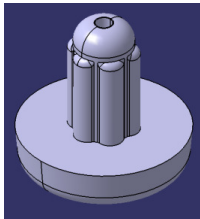

Old type of rubber feet - 50280807004

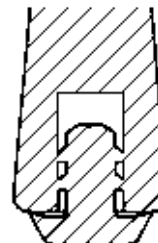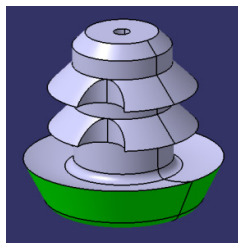

New type of rubber feet - 4055381125

SPARE PART NUMBER:

Spare part code of pan supports, which can be ordered in case of damage are as follows:

Old pan supports	New pan supports	Description
3546505029	3546586029	Equipped with new version of rubber feet
3546507017	3546591029	Equipped with new version of rubber feet

MODELS INVOLVED:

The above way of repair is valid for all PNCs which are equipped with above pan supports.

REVISION:

Revision	Date	Description	Author	Approved by - on
01	02/2018	Document Creation	Ewelina Fidor	Massimo Collini 2018-02-06
00	03/2016	Document Creation	Ewelina Fidor	Massimo Collini 2017-03-02