



Hard to re-open door reduce the time between door openings (FzFF240 and FzFF280)

DESCRIPTION:

Issue with door re-opening in free standing freezer appliances.

SOLUTION:

The cause of the problem could be the attempt to re-open the door immediately after closing. To avoid customer claims, it is possible to implement a valve to reduce vacuum and re-opening time.

This solution modifies the appearance of appliances.



Freezer
FzFF240/280



1. Take out the bottom drawer.

2. Drill a hole with a 27mm drill to the left side of the inner liner.


Parameters:

50mm from the bottom and 20mm from the side.

If the hole does not fully penetrate – place the centre tip in the small hole created on the back and complete from the back.

Or if you clean the hole saw, you can “reboot” and finish it from the front side if the drill is long enough.



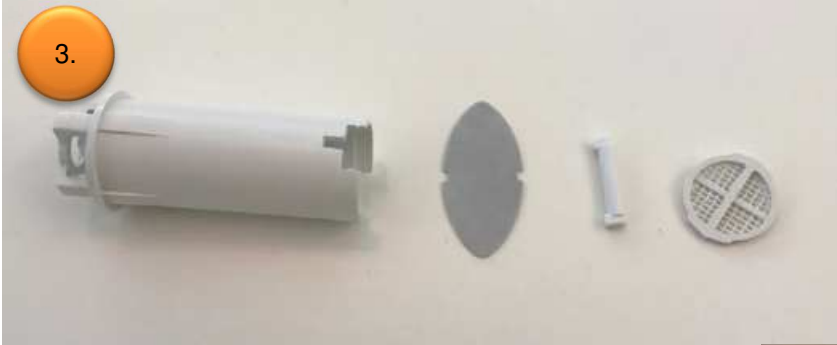

3. Assemble the valve according to the instructions supplied with the valve.
Place the valve in the hole.
Put back the drawer.



**SPARE PARTS:**

Spare part number	Description
4055269494	Valve, Kit

QES CODE:

During the intervention, please use codes:

Component	167, 161, 200, 220, 226
Defect	20, 10, 07, 13

Models involved:

Base Model	PNCs
FzFF280	9250528xx, 9250529xx
FZFF240	9250702xx

Revision:

Revision	Date	Description	Author	Approved by - on
00	12/2017	Document Creation	Zsuzsanna Mihalik	Attila Heri
01	10/2020	Document revision, update of PNC list	Anna Grimlund	Szabina Czuczorné Seres Judit Hudákné Szabó