

# SERVICE BULLETIN DISHWASHERS

# DOROTEA-DOMODOSSOLA: 2nd Gen. Auto door open

#### **DESCRIPTION:**

Cases haves been detected in field where the users complaint that the cycle doesn't start or the door doesn't close.

- 1) Cycle doesn't start (90% of the cases)
- 2) Door doesn't close (10% of cases)


The cause highlighted from the analysis of the faulty parts is the breakage of the micro activation lever of the ADO






The breakage of the lever occurs for a misalignment of the diamond fixed on the inner door, respect to the hooks of the door lock and it can be due to:

- a) Dishwasher not well levelled (picture a)
- b) Inner door and/or upper cross bar deformed and the diamond remains below the door lock hooks (picture b)

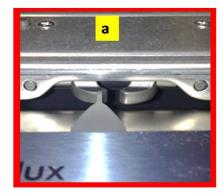

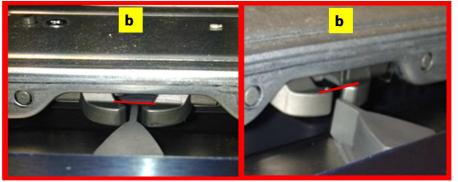



EN Q&CI-TS AR 1/3 599 82 14-67 Rev.00

#### **INSTRUCTION:**

In case of intervention is important to check that the dishwasher is levelled correctly and that the structure or the inner door has not been deformed during the handling/transport

a) The diamond must be centered between door lock catchers.

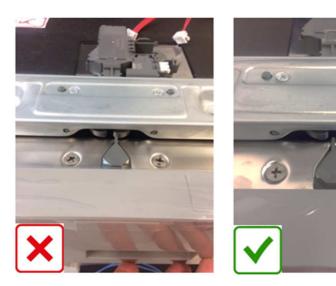

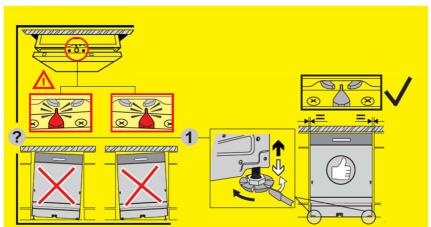

b) The diamond should be at least levelled or higher than door lock catchers. If it remains below the hooks, the inner door or the upper cross bar has been deformed.

A bending action on the cross bar is needed to bring the door lock in the correct position respect to the diamond (see picture below)



## **MODELS CONCERNED:**

- 60cm and 45cm Models with 2nd generation Door lock with Auto door opener from Italy (Dorotea) and Poland (Domodossola)

## **REVISION:**

Revision	Date	Description	Author	Approved by
00	7/2018	Document creation	Rui Almeida	Claudio Pigaiani

EN Q&CI-TS AR 3/3 599 82 14-67 Rev.00