

Comfort Lift: I30 Alarm

DESCRIPTION:

Alarm I30 because of water leakage on the sides of the tub.

Water leakage from the nut of the comfort lift module.



SOLUTION:


Tighten the nut but also add the Loctite (see below) on the thread. To avoid the same problem in the future add the Loctite on all the threads and tight all the nuts of the module. Use a manual tool not an automatic one (max force torque 4,5Nm).



spare part code	Spare description
4055349858	Lock nut,LOCTITE,5ml

Since the exterior nuts are metallic and fixed on a plastic part the thread of the plastic part may be damaged in case too much force is used when fixing the nuts.

Sequence of tightening the nuts.

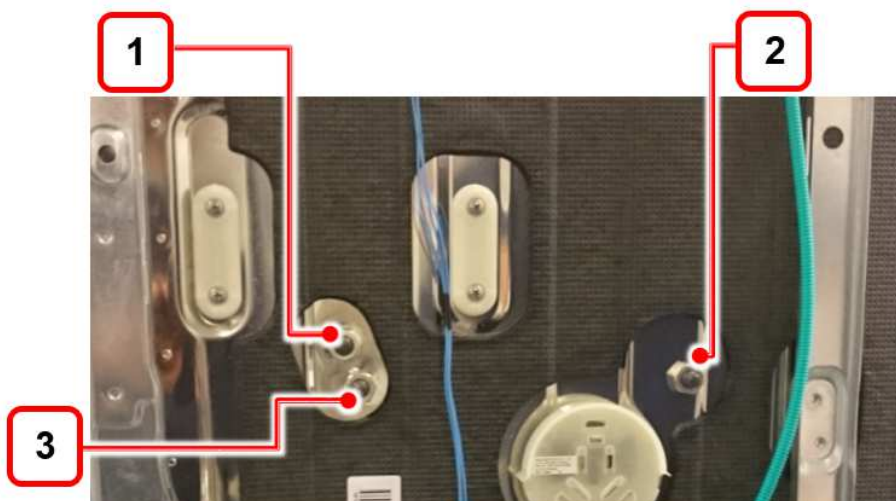

MODELS CONCERNED:

- Comfort lift models

REVISION:

Revision	Date	Description	Author	Approved by - on
00	10.10.2018	Comfort Lift I30 Alarm	Rui Almeida	Claudio Pigaiani