

SERVICE BULLETIN REFRIGERATION FS FRIDGE AND COMBI BOTTOM

ICE FORMATION IN THE FRIDGE AREA

DESCRIPTION:

This service bulletin describes the following scenarios:

Ice formation due to goods placed by the back wall of the appliance.



Use a back trim to create a barrier with the back wall.

Spare part numbers:

2089650010: Strip edge. Glass shelf, back, 7801, 519

mm.

8078174276: Strip edge, Glass shelf, front, 487 mm.

Ice on one side only: Blockage in the cooling system or not enough gas.



Empty the refrigerant system. Reload with gas and close it.

In both scenarios, defrost the appliance and make sure that the appliance is fully dry before starting it up.

Use the following QES Codes when reporting the Service Order:

I	Component	161,205,902
	Defect	80,13,

Models involved:

FS Combi/Cabinets 925 0** ***

REVISION:

1/2 1/4/4						
Revision	Date	Description	Author	Approved by - on		
00	10/2019	Document Creation	Anna Grimlund	Attila Héri/Judit Hudákné Szabó		