

SERVICE BULLETIN REFRIGERATION BUILT IN

Combi bottom frost free - cracking noise

DESCRIPTION:

Noise in appliances equipped with a freezer cold module (freezer battery with fan and heating element).


CAUSE:

The noise comes from the plastic assembling guide used for the pipe. This was introduced in production in week 29/2019.



SOLUTION:

Seal the plastic guide using Silicone with spare part 4055071353 -Sealing compound.

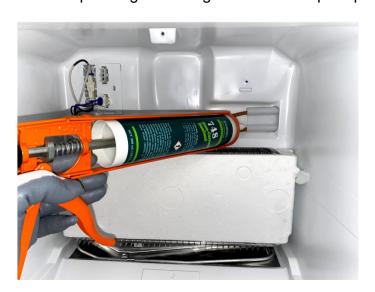



MODELS CONCERNED:

| PNC | From | То |
|-------------|---------|---------|
| 925 504 xxx | 2019/29 | 2020/03 |
| 925 506 xxx | 2019/29 | 2020/03 |
| 925 505 xxx | 2019/29 | 2020/03 |
| 925 516 xxx | 2019/29 | 2020/03 |
| 925 501 xxx | 2019/29 | 2020/03 |

QES CODE:

Use the following QES Codes when reporting the Service Order.

Component: 101 Casing/Cabinet with parts Defect: 09 Noise

SPARE PART:

| Spare part number | Description |
|-------------------|-------------------|
| 4055071353 | Sealing compound. |

REVISION:

| Revision | Date | Description | Author | Approved by |
|----------|---------|-------------------|----------|-------------|
| 0 03 | 03/2020 | Document creation | Anna | Stefania |
| | 03/2020 | | Grimlund | Piccin |