

Technical Bulletin Nº CB1008


Issue: 1 Date: 6/16

Intermittent Faults Control Panel

Fault: The controller is unresponsive to touch, randomly changes its function, temperature or the graphics appear to have lines through them.

The most probable cause is the brackets which hold the controller in place against the control panel glass. There was an issue with the fixing method of the brackets which was resolved at serial number 45020001.

Fix: Change the <u>control panel</u> only. (spares stock has been replaced with good parts)

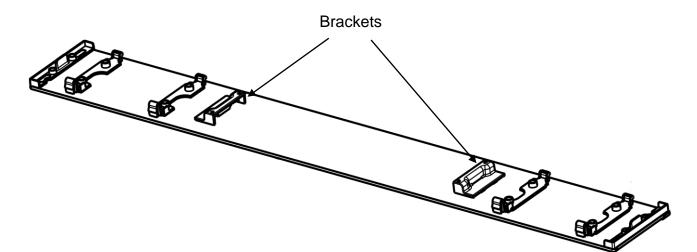

Model	PNC	Panel
EFE956BA	940001798	0038 012 638
EVE916BA	944031650	0038 012 638
EFE916BA	943000897	0038 012 788
BE7900061M	944031663	0038 012 847
49669GO-MN	943000910	0038 012 845