

SERVICE BULLETIN


NEW RUBBER GASKET

DESCRIPTION:

It has been discovered in the laboratories of the Siewierz factory (Poland) that in some dryers, after working hours in extreme conditions, on the motor shaft, which activates the front fan (hot air circulation) there was excessive humidity and cloth fibres came out from the front scroll. To avoid any possible malfunctioning a new basket has been introduced between the motor shaft and the front scroll cover.

AFFECTED MODELS:

All B class condensed dryers, identified by the presence of 2 condensers and one relay.

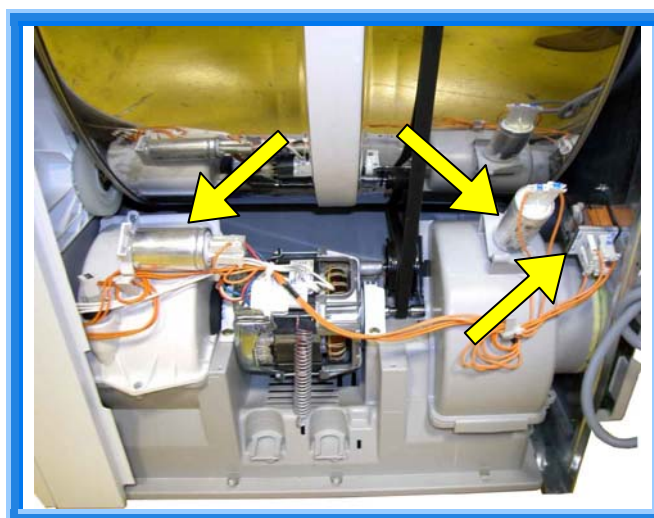

Before modification



After modification



SPARE PARTS:

Should similar problems arise on the above mentioned appliances without the gasket, it is advisable to remove the front scroll and to insert the gasket part no. **125 64 26 00-6** between the motor shaft and the scroll, as shown in figure and inform the Electrolux service department about the problem (error code 03).

