

Cookers


599 526 071 ΕN

Built-in ovens with "Avantgarde" Input Electronics


It is possible when commissioning an induction hob that the Avantgarde Oven Electronics Problem: automatically resets, whether the oven is in operation or not. It then reacts like a voltage cutoff and all settings (clock, language etc) should be adjusted again.

Cause: Perturbances on the data lines by parallel installation with load lines.

Remedy: Install data and load lines in isolated ways, refer to bundling photographs.

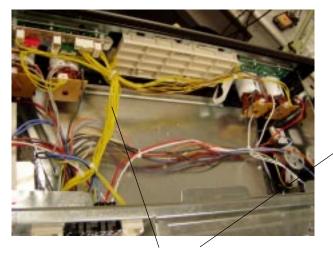

Data lines

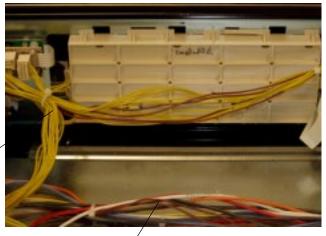

Load lines



DGS-TDS-N © Electrolux 06.03.06

