

INTERNAL DOOR FRAME REPLACEMENT ON VENTED DRYERS.

DESCRIPTION OF PROBLEM:

Reason for changing Internal Door Frame in vented dryers is to eliminate the possibility to get the laundry (with buttons) in the space between Air Duct and external surface of Internal Door Frame.

MODELS AFFECTED:

All models of vented dryers with internal door frame number:

- 125 79 20 10 6
- 125 79 20 30 4

SOLUTION:

To eliminate possibility of going buttons to critical area it is necessary to change Internal Door Frame. New Internal Door Frame is equipped with additional flanges (marked in red).


Old Internal Door Frame:

- a) 125 792 010 6
- b) 125 792 030 4



New Internal Door Frame:

- a) 125 792 011 4
- b) 125 792 031 2

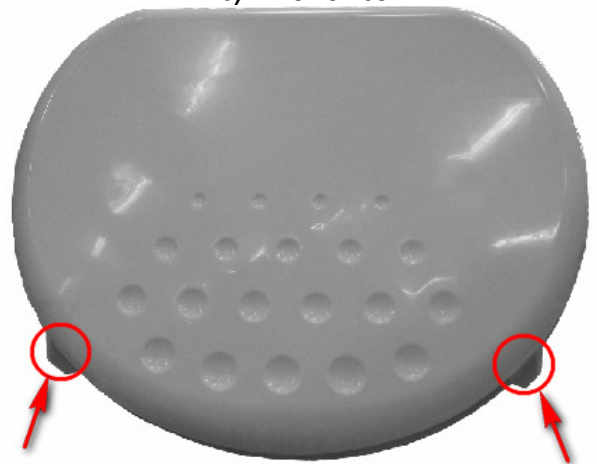

Modification was introduced into series production on 1st of February 2010.