




'18' on Kite or '3 67' on Falcon pulsing on display


DESCRIPTION:

Induction hob controlled by Kite user interface shows a pulsing '18' on both left zones (approximately 5 seconds on, 5 seconds off),

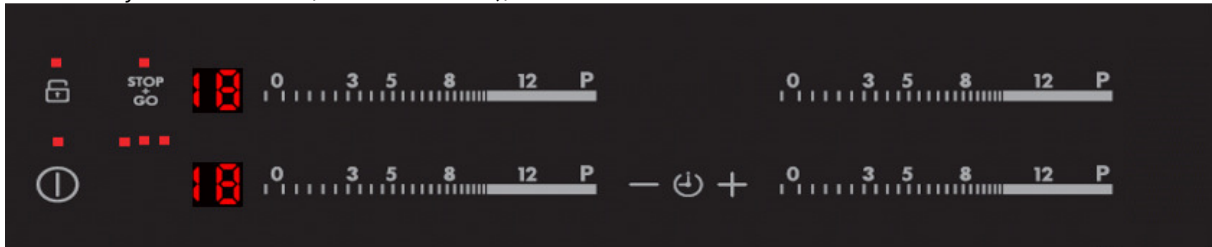

OR

Induction hob controlled by Kite user interface shows a pulsing '3 67' on rear left zone and timer display (approximately 5 seconds on, 5 seconds off)

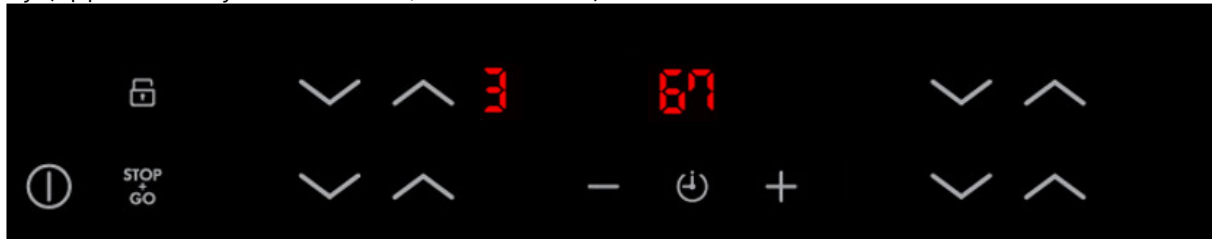

SOLUTION:

Recommended repair solution is :

1. Change the induction board that has a jumper on it,
2. No user interface replacement is necessary
3. Report in QES as 851 Induction module / unit.

SPARE PART NUMBER:

To define a spare part number for the induction model please refer to a relevant spare part list.

REVISION:

Revision	Date	Description	Author	Approved by - on
01	09/2016	Text corrections	Marcin Kobialka	Josef Leis
00	06/2016	Document Creation	Marcin Kobialka	Josef Leis