



**SPARE PART REPLACEMENT
CONDENSATION SOLUTION /CHANGE NEW HEATER FLIP MULLION**


DESCRIPTION:

Due to condensation at flip mullion guide and FC door, the heater wiring part number 140045268012 (A04526803) was fold and torn.



SOLUTION:

Improve new concept locking PVC tube not to move and increase length of PVC and add clip support.

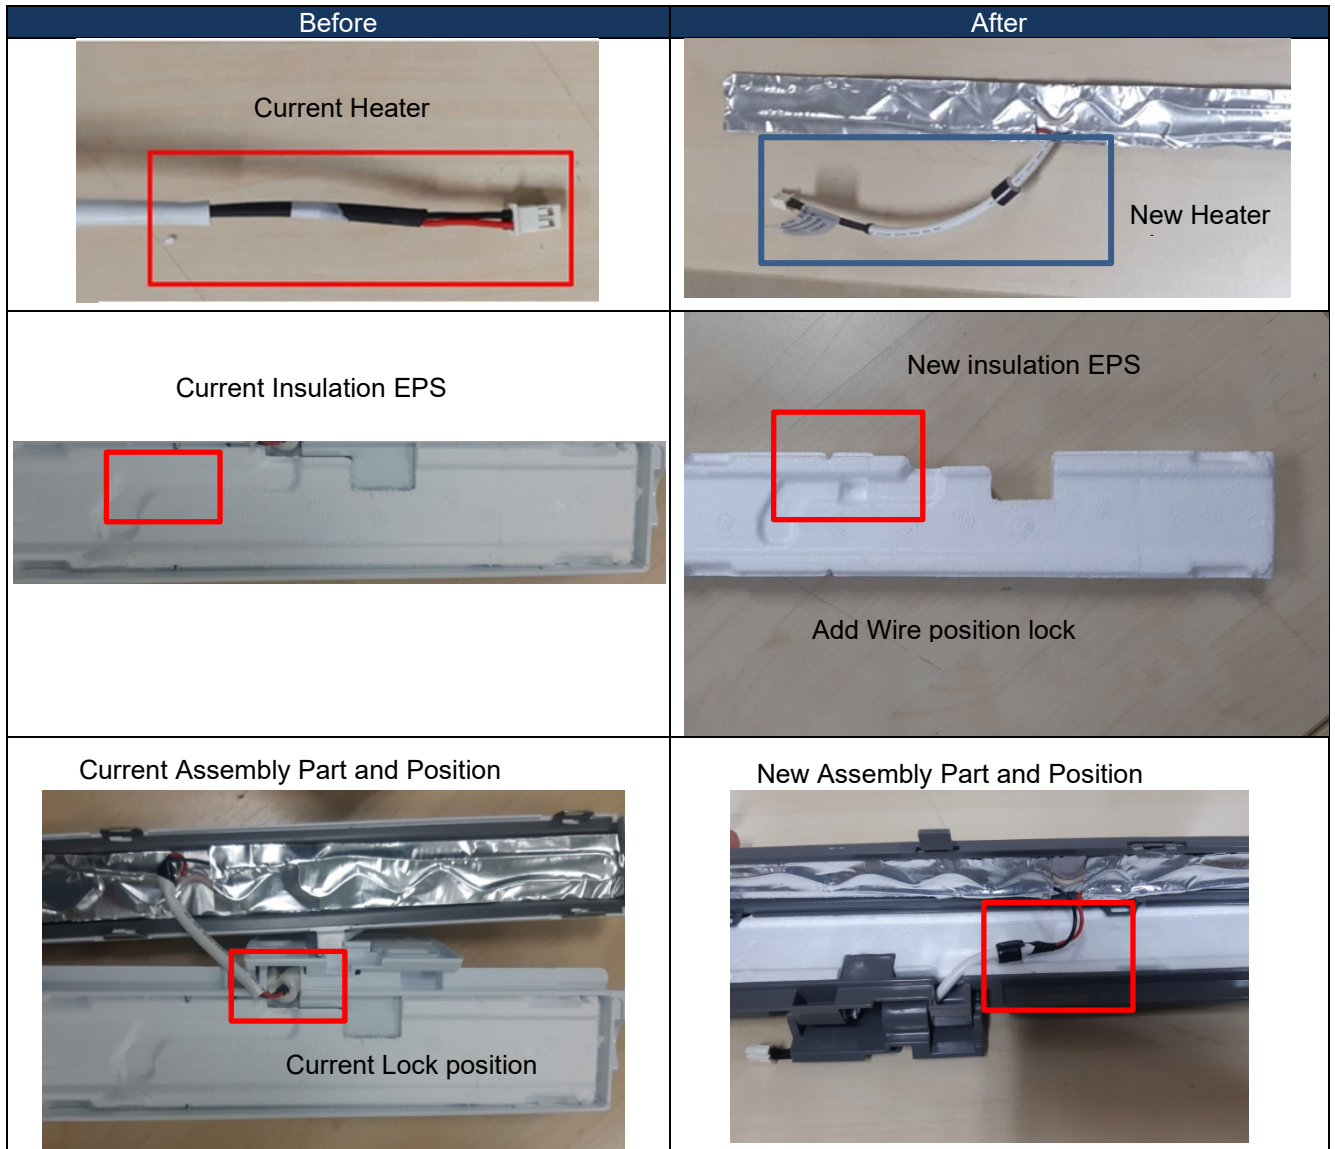

SPARE PART NUMBER:

| Old spare part code | Old Description | New spare part code | Description |
|---------------------|-------------------------------|---------------------|---------------------------------------|
| A03987901 | Flip Mullion Assembly Gr MD36 | 140039879014 | COLUMN,FRIDGE DOOR,ASSEMBLY,82 |

MODELS INVOLVED:

All range of Multidoor refrigerators

INTERCHANGEABILITY:

Describe the possible replacement of the old code with new ones.

REVISION:

Describe the revisions using a table with borders and bold headlines in lowercase with initial capital:

| Revision | Date | Description | Author | Approved by - on |
|-----------------|-------------|--------------------|-------------------------|--------------------------|
| 00 | 09/2021 | Document Creation | Wareerat Lerchakittikul | Vatcharapong Simadamrong |