
SERVICE BULLETIN WASHING 2520-2530

LEAKAGE ON THE BOTTOM DUE TO THE BROKEN INLET VALVE HOSE

Due to the clogged water distributor inlet valve hose can be damaged.

DESCRIPTION:

On the picture below you can find example of broken inlet valve pipe and clogged water distributor.

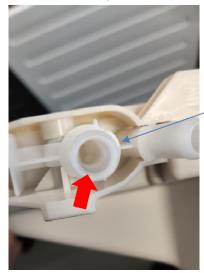



Clogged water distributor channel and cracked inlet valve pipe.

SOLUTION:

In such case, please exchange related to PNC inlet hose pipe and water distributor:

SPARE PART NUMBER:

Old spare part code	New spare part code	Description
Related to PNC	Related to PNC	Inlet valve pipe / water distributor

QES CODE:

During the intervention please use work codes:

zamig and macromatic product and many course.						
Component	G10	505 Dispenser hose				
Defect	G10	08 Cracked/Split/Broken/Fractured				

MODELS INVOLVED:

All washing machines.

REVISION:

Revision	Date	Description	Author	Approved by - on
00	11/2022	Document Creation	Adam Słoma / Rui Almeida	Adam Słoma