

SERVICE BULLETIN

Dometic GmbH, In der Steinwiese 16, D-57074 Siegen

RM 8405, RM 8505, RM 8555, RML 8555, RMS 8405, RMS 8465, RMS 8505, RMS 8555

Software AES 8er-Serial

It might happen, that fridges mentioned above up to serial number 801xxxxx do not switch to DC in automatic mode, while the engine of the vehicle is running.

This happens, if the +12V DC heater wire is switched with a ignition relay and get the D+-signal at the same time (Fig. 1).

This problem could be solved by rewiring (Fig. 2)

The actual electronics, spare part number 241 3423-10/0 are changed, now the electronics works at both kinds of wiring.

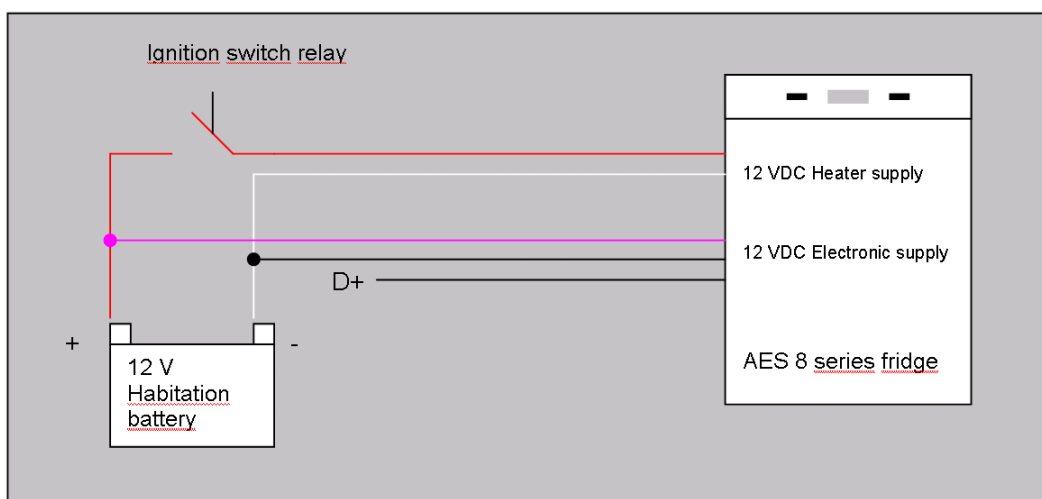


Fig. 1

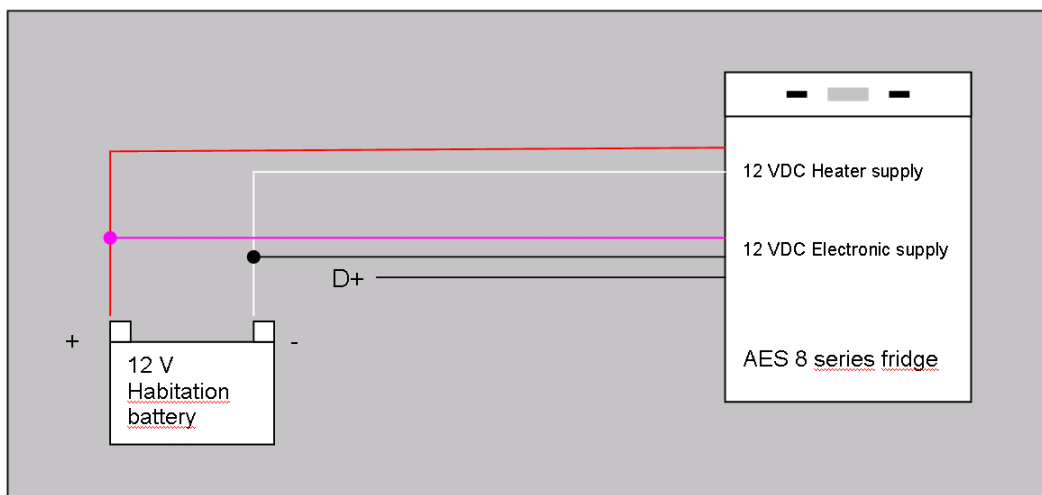


Fig. 2