

SERVICE BULLETIN

Dometic GmbH, In der Steinwiese 16, D-57074 Siegen

RMD 8501, RMD 8505, RMD 8551, RMD 8555, RMDT 8501, RMDT 8505, RMDT 8551, RMDT 8555

Problems with condensation

1. Condensation around the operating panel

In case of condensation around the operating panel please install the following service kits:


289 0347-02/0, RMD/T 85x1
289 0347-12/9, RMD/T 85x5

These service kits comprise the new electronics 289 0347-03/8 for MES or 289 0347-13/7 for AES (frame heating is not switched off automatically after two hours), an insulating seal for the freezer compartment door 293 5688-21/4 and an instruction 210 6513-54/8.

All parts can also be purchased individually.


Exchange of the electronics 289 0347-03/8 (MES) or 289 0347-13/7 (AES)

The electronic is programmed to switch on the frame heating automatically whilst operation on 12V and mains and to allow switching on or off the frame heating manually whilst gas operation.

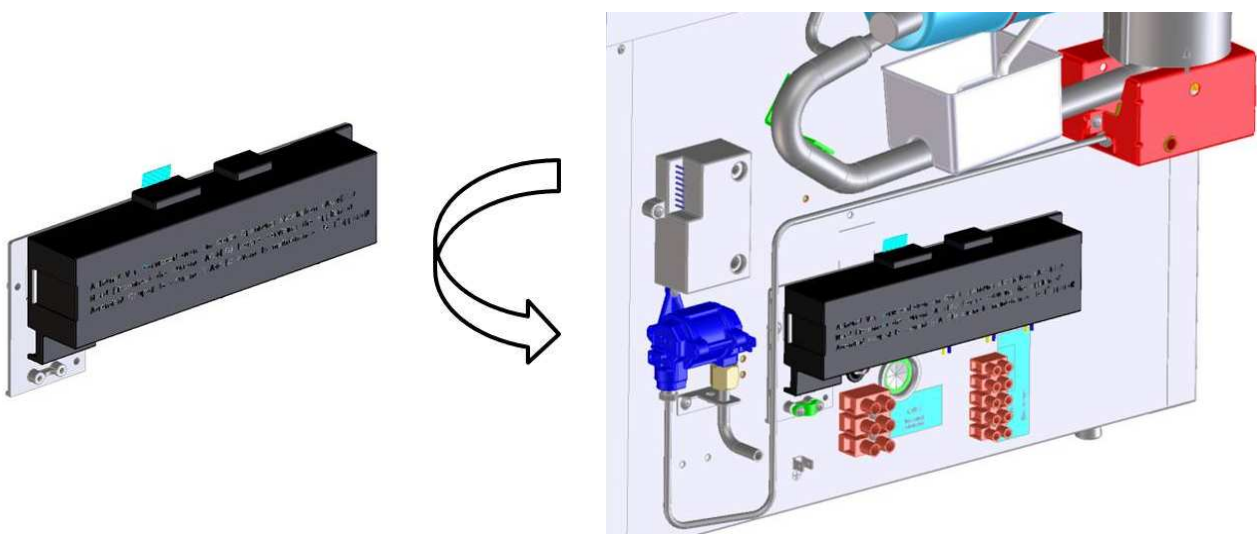

2. Condensation on the freezer compartment door around the lock

Mounting the insulating foam strip 293 5688-21/4.
Please read the service bulletin 599 7471-57.

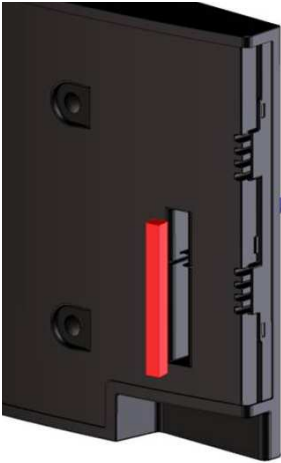

3. Condensation in the inner liner and icing-up of the evaporator in the freezer compartment

In case of condensation spreading from the freezer compartment to the inner liner via the freezer compartment bottom please install the seal 295 1227-31/9.

