

Washing Group Replacement


DESCRIPTION:

Welded washing group **1268576418** is no longer available; it has been replaced by an assembly kit number **4055173779**

SOLUTION:

In case of exchange, the following components need to be replaced:

SPARE PARTS:

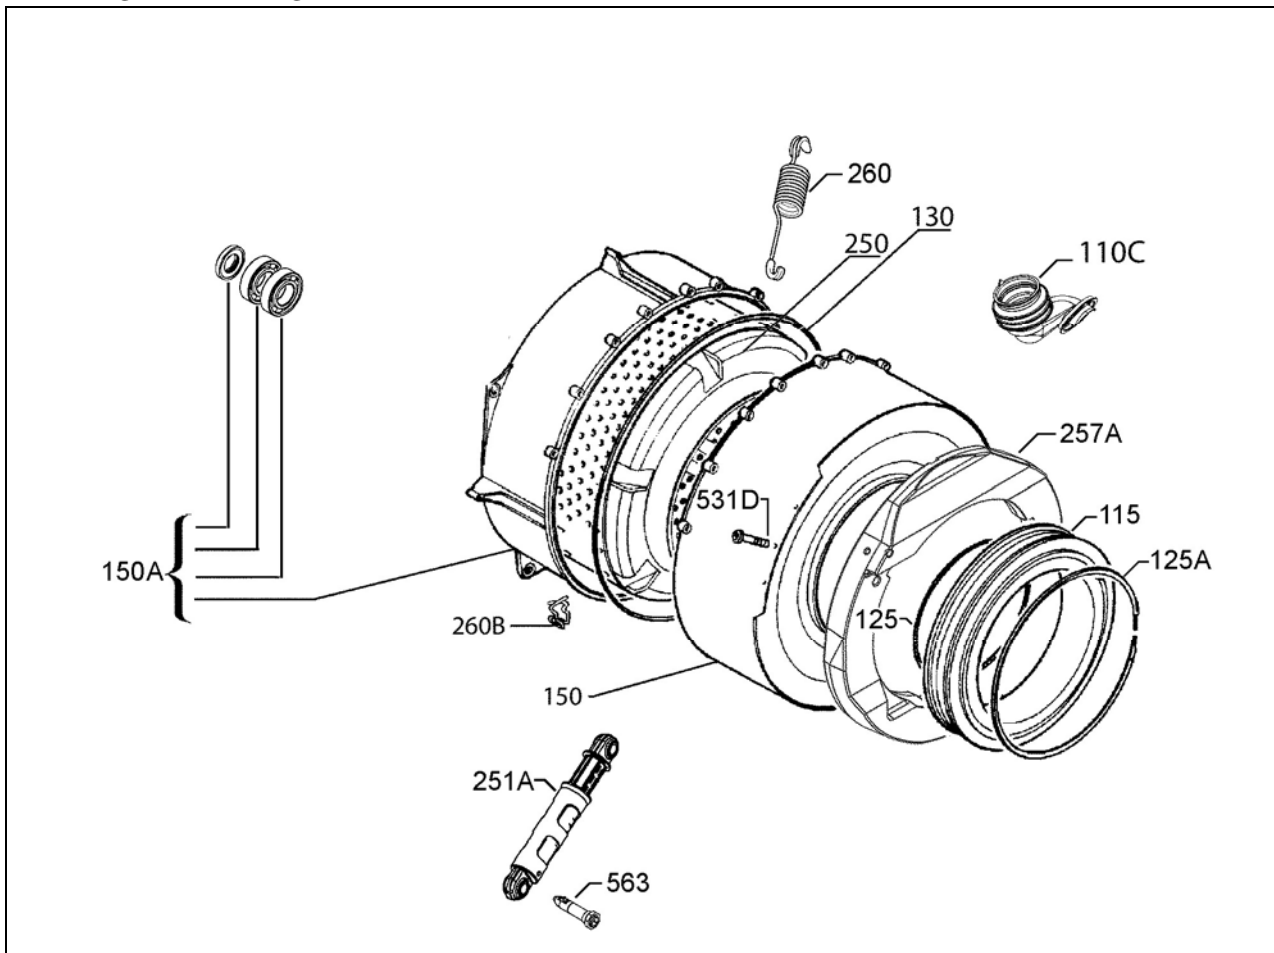

Kit 4055173779 contains of:

Position	Spare part description	Spare part number	Quantity
110C	Hose bend, water inlet compartment	110872200	1
115	Rubber bellow, porthole	13200410	1
125	Fixing spring, rubber bellow, tub	13200240	1
130	Gasket, shell, tub	12401590	1
150	Shell, front, tub, G20/G21	124965747	1
150A	Assembly, shell, back	132683270	1
250	Drum assembly G20 1200/1350 R"	132651900	1
251A	Shock absorber	132255301	2
257A	Front counterweight.13.5KG GREEN	110847950	1
260	MUELL.SUS.GRUPO (G19-G20)	126063351	2
260B	Heating element spring	124782510	1
125A	Glass, porthole	132224500	1
531B	Screw, shell, tub	132229010	17
531D	Counterweight screw 8X47	132658901	5
563	Bolt, cushion	126053400	4

MODELS INVOLVED:

PNC	Date	Model name	Brand
91422610301	20090213	ZWF14070W1	Zanussi
91422610302	20090417	ZWF14070W1	Zanussi
91422615102	20090227	FWG3139	Faure
91422615402	20090220	FWG5145	Faure
91422615502	20090220	AW1402W	Tricity Bendix
91422615700	20090227	FWG5145	Faure
91422615701	20090417	FWG5145	Faure
91422615801	20090424	FWG3139	Faure

REVISIONS:

Revision	Date	Description	Author	Approved by - on
00	12/2011	Document Creation	OW	BD 12/2011