





Repair E9 error displayed on User interface Kite

DESCRIPTION:

In Induction hobs, E9 error can be displayed on User Interface Kite. It is caused by old plastic carrier pressing on the solder joints of Kite C.

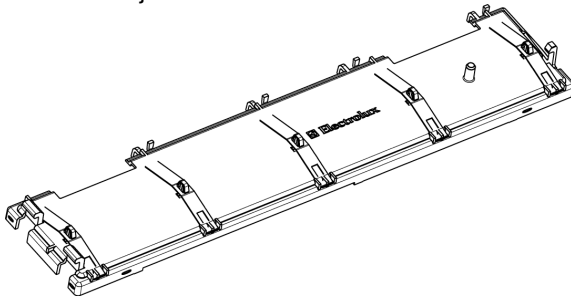

Current used plastic carrier

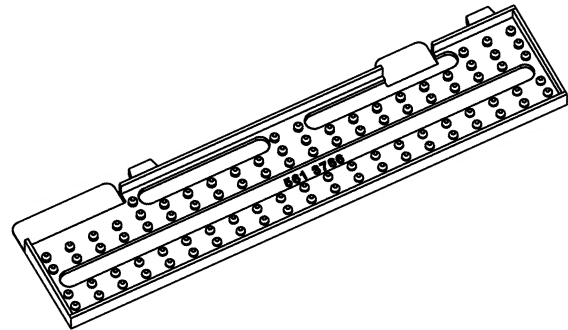

New silicone carrier

SOLUTION:

To repair E9 error displayed on User Interface Kite, it is required to exchange User Interface Kite C and additionally order silicone version of carrier according to table below.

SPARE PART NUMBER:

Spare part code of carrier, which is required to be ordered in case of E9 error displayed on User interface Kite.

Current used plastic carrier	New silicone carrier	Description
5617622112	5613766202	In case of E9 error

MODELS INVOLVED:

The above way of repairing is valid for PNCs affected with Kite C and produced between week 9/2015 up to week 51/2015 i.e. from serial number 509xxxxx up to 551xxxxx.

List of PNCs involved in the above way of repairing is as follows:

PNC	MODEL	BRAND
94959432601	PAI8105E FC9	Progress
94959435901	GK78TSICNC GV6	Electrolux
94959439300	JKS1808F5 HW3	Juno
94959439400	JKS1808R5 HW4	Juno
94959502601	HK854220XB FF8	AEG
94959502701	HK854220FB FF6	AEG
94959502801	HK854220IB FF7	AEG
94959503501	HK854400XB FB5	AEG
94959503601	HK854400FB FB3	AEG
94959503701	HK854400IB FB4	AEG
94959503801	HK854400XS FA8	AEG
94959503901	HK854400FS FA5	AEG
94959508401	HK854400FB FB3	AEG
94959508501	HK854220FB FF6	AEG
94959508801	HK854200FB EW2	AEG
94959514301	DIK3484-UR FB8	Voss-Electrolux
94959514401	DIK3484-FR FB7	Voss-Electrolux
94959514501	DIK3483-FR CV0	Voss-Electrolux
94959520501	KFA78DIM FF8	AEG
94959520601	KFA78DIO CM5	AEG
94959522601	HK854320FB FF9	AEG
94959526100	HK854206XB EW4	AEG
94959532600	HK854401XB GA8	AEG
94959532700	HK854401FB GA9	AEG
94959532800	HK854401IB GB1	AEG

PNC	MODEL	BRAND
94959535400	HK854326IB FG1	AEG
94959539700	HK854401FB GA9	AEG
94959544700	HKA83450FB FF9	AEG
94959554101	ZEI8740BBA EX8	Zanussi
94959562000	ZEM8740XBA HK8	Zanussi
94959562100	ZEM8740FBA HK9	Zanussi
94959562200	FEM8740FBA HL1	Faure
94959632800	EHH8540I8K HV7	Electrolux
94959635900	EHL8540FHK HJ3	Electrolux
94959639400	EHL8540IHK HX5	Electrolux
94959641900	HOB850F HJ3	Electrolux
94959645900	HOB850F IM4	Electrolux
94959649200	GK78TSIO JC2	Electrolux
94959649300	GK78TSICN JF5	Electrolux
94959702800	HK8542H1FB HH6	AEG
94959703000	HK8542H1XB HN9	AEG
94959703400	HK8542H0XB HH7	AEG
94959703500	HKL85410FB HH8	AEG
94959703700	HKL85410IB HP4	AEG
94959703800	HKL85410XB HP5	AEG
94959706500	HKM85440IS HK5	AEG
94959706600	HKM85440XS HK6	AEG
94959707900	HDM54108XB GA8	AEG
94959714000	HKL85416XB HP5	AEG
94959714500	HKA8540IND GA8	AEG

REVISION:

Revision	Date	Description	Author	Approved by - on
00	02/2016	Document Creation	Ewelina Fidor	Josef Leis 2016-02-17