



Mounting way of new timer version in place of the old one

DESCRIPTION:


In ovens, old timer will be no longer available. New implemented timer is not fully compatible with the old one due to necessity of control panel exchange, knob exchange in some cases and reworking process of wiring additionally.

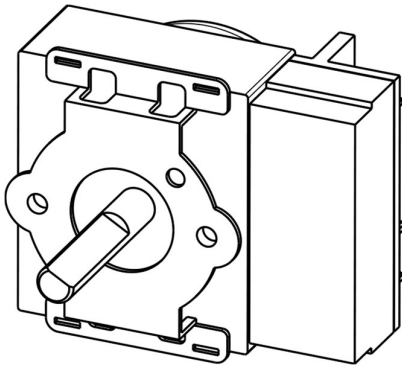


Old type of timer

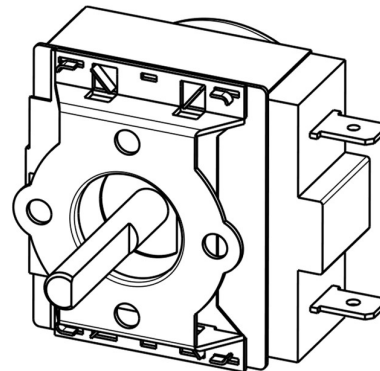


New type of timer

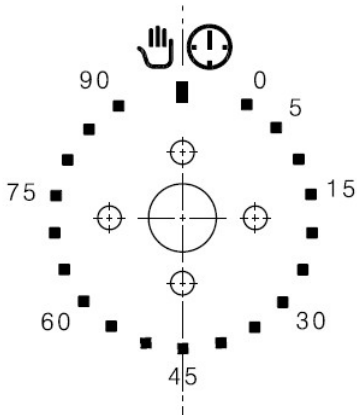


Minute minder and holes positions of old control panel

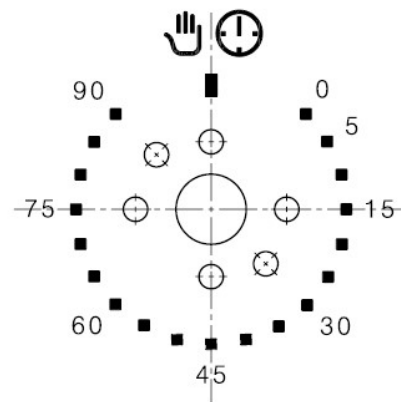

Minute minder and holes positions of new control panel

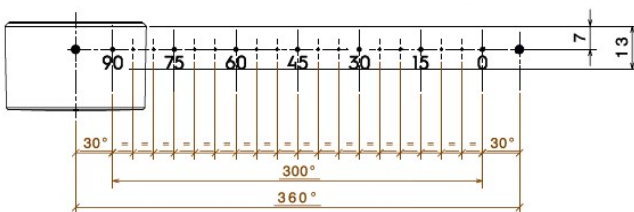

Minute minder positions of old knob

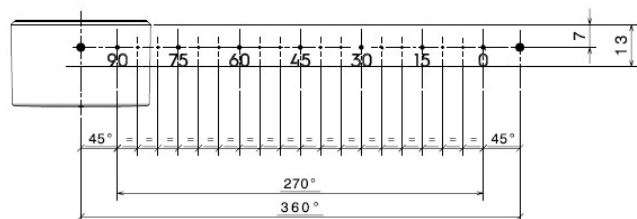

Minute minder positions of new knob

SOLUTION:

Way of repair depends on type of appliance.


Scenario 1: Appliances with minute minder symbols printed on control panel

In case of old timer damaged, it is required to order new type of timer, new type of control panel and rework wiring by usage of 2 pieces of the new cable and 2 pieces of the new connector covers.



Scenario 2: Appliances with minute minder symbols printed on knob

In case of old timer damaged, it is required to order new type of timer, new type of control panel, new type of knob dedicated to timer and rework wiring by usage of 2 pieces of the new cable and 2 pieces of the new connector covers.

To rework wiring follow instruction below.

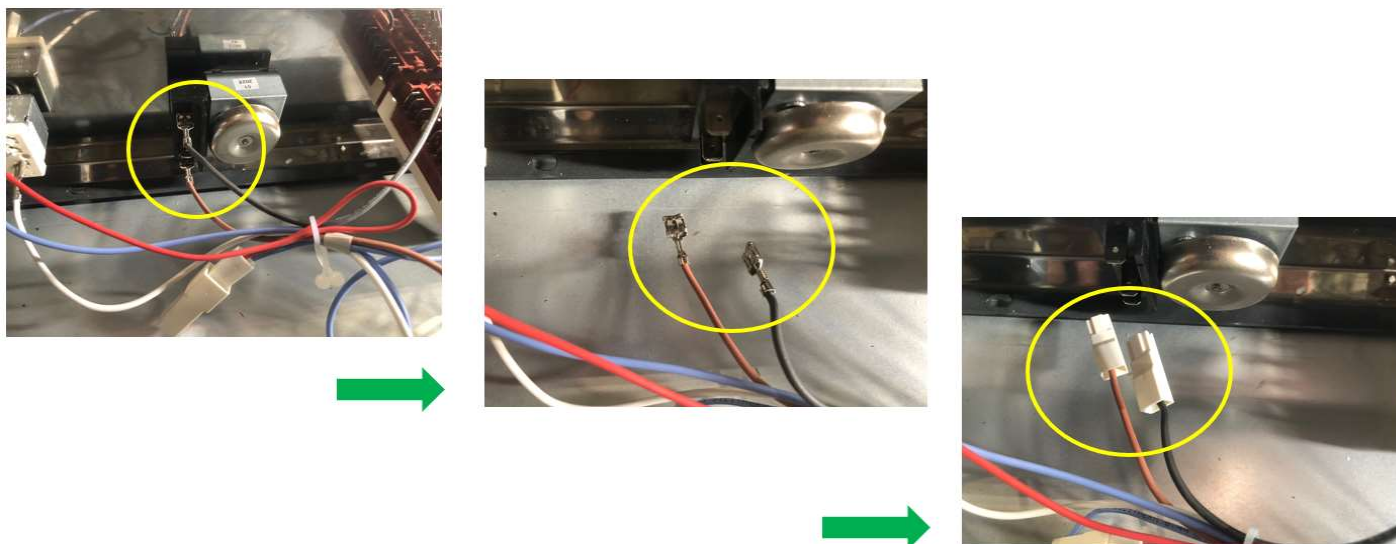

Step 1: Disconnect 2 fastons from the timer and insert 2 new connector covers

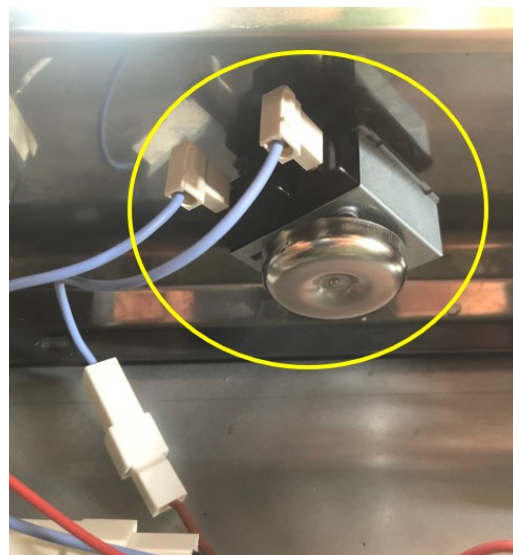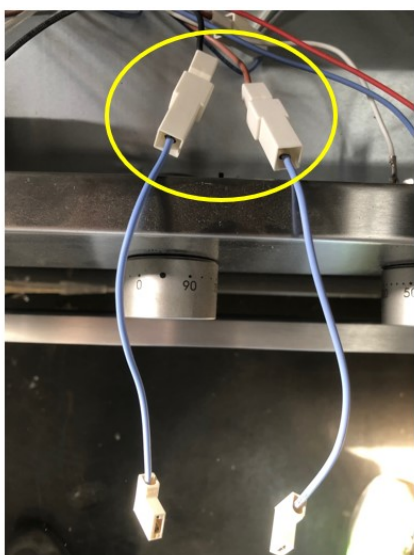

Step 2: Connect 2 new connector covers to new delivered cables

Step 3: Connect the other end of the cables to new timer

SPARE PART NUMBER:

PNC	Timer		Control Panel		Knob		New cable (2 pieces need to be ordered)	New connector cover (2 pieces need to be ordered)
	Old	New	Old	New	Old	New		
949496103	3570687016	140216604011	140129197012	140129197020	-	-	140231930011	5610455015
949496118	3570687016	140216604011	8070231041	8070231066	-	-	140231930011	5610455015
949496221	3570687016	140216604011	140141272017	140141272025	-	-	140231930011	5610455015
949496248	3570687016	140216604011	140204955011	140222685012	-	-	140231930011	5610455015
949496249	3570687016	140216604011	140205017019	140222686010	-	-	140231930011	5610455015
949496273	3570687016	140216604011	140193997016	140193997032	-	-	140231930011	5610455015
949496288	3570687016	140216604011	140194052050	140194052118	-	-	140231930011	5610455015
949496304	3570687016	140216604011	140205017050	140222686051	-	-	140231930011	5610455015
949496305	3570687016	140216604011	140205017043	140222686044	-	-	140231930011	5610455015
949496314	3570687016	140216604011	140204038016	140204038024	-	-	140231930011	5610455015
949496704	3570687016	140216604011	3539330161	3539330245	-	-	140231930011	5610455015
949496705	3570687016	140216604011	3539330187	3539330260	-	-	140231930011	5610455015
949496707	3570687016	140216604011	3539330153	3539330237	-	-	140231930011	5610455015
949496708	3570687016	140216604011	3539330179	3539330252	-	-	140231930011	5610455015
949496709	3570687016	140216604011	3539330161	3539330245	-	-	140231930011	5610455015
949496714	3570687016	140216604011	3539272033	3539272041	-	-	140231930011	5610455015
949496722	3570687016	140216604011	3539272033	3539272041	-	-	140231930011	5610455015
949496726	3570687016	140216604011	140204955011	140222685012	-	-	140231930011	5610455015
949496727	3570687016	140216604011	140185502022	140185502089	140185168188	140185168329	140231930011	5610455015
949496728	3570687016	140216604011	140185502030	140185502097	140185168196	140185168337	140231930011	5610455015
949496729	3570687016	140216604011	140185502014	140185502071	140185168170	140185168311	140231930011	5610455015
949496730	3570687016	140216604011	140185805029	140185805060	140185168196	140185168337	140231930011	5610455015
949496731	3570687016	140216604011	140185805011	140185805052	140185168170	140185168311	140231930011	5610455015
949496732	3570687016	140216604011	140194052043	140194052100	-	-	140231930011	5610455015
949496733	3570687016	140216604011	140194052050	140194052118	-	-	140231930011	5610455015
949496734	3570687016	140216604011	140194052019	140194052092	-	-	140231930011	5610455015
949496736	3570687016	140216604011	140185502014	140185502071	140185168170	140185168311	140231930011	5610455015
949496737	3570687016	140216604011	140185502048	140185502071	140185168261	140185168311	140231930011	5610455015
949496738	3570687016	140216604011	140185502014	140185502071	140185168261	140185168311	140231930011	5610455015
949496739	3570687016	140216604011	140185502030	140185502097	140185168287	140185168337	140231930011	5610455015
944064897	3570687016	140216604011	140128967050	140128967068	-	-	140231930011	5610455015
944064517	3570687016	140216604011	3539194013	3539194229	-	-	140231930011	5610455015

MODELS INVOLVED:

The above way of repair is valid for all appliances listed in table above.

REVISION:

Revision	Date	Description	Author	Approved by - on
00	10/2021	Document Creation	Ewelina Średniawa	Giovanni Rinaldo 2021-10-18