


**SERVICE BULLETIN**

**WATER INLET COMPARTMENT**

**DESCRIPTION:**

In the dishwashers produced in the Solaro (MI) factory, a new water inlet compartment will be gradually introduced with reduced dimensions and with a longer hose to connect the solenoid valve.

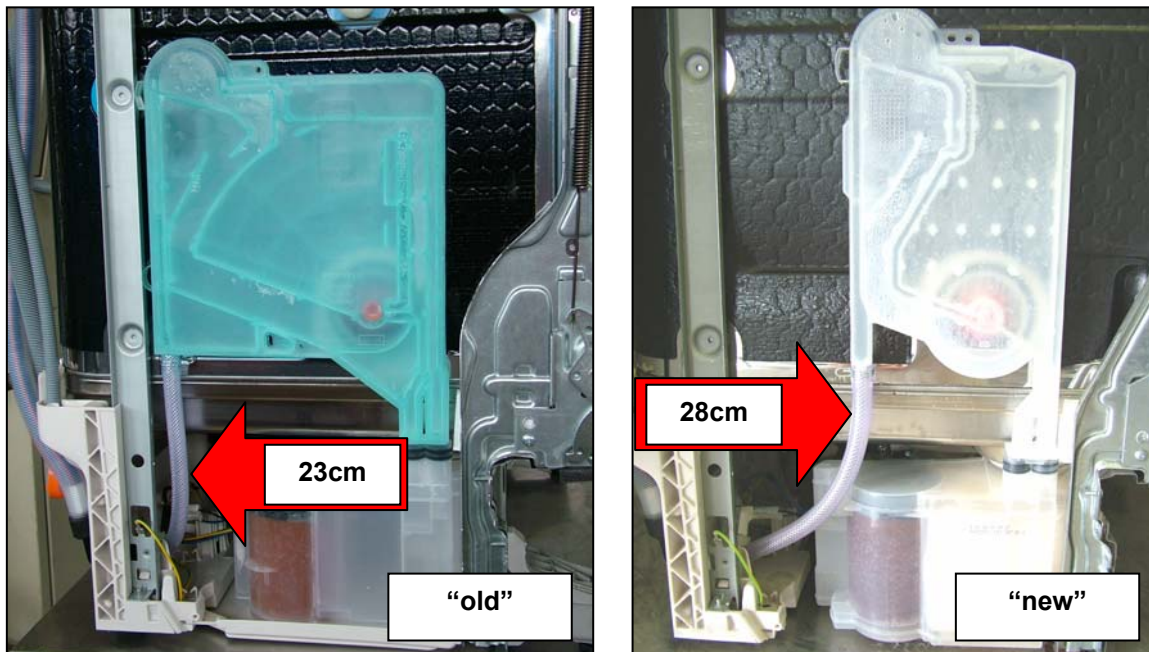

**AFFECTED MODELS:**

All electronic dishwasher models with “ACTIVE” drying will be affected.

All electronic with “Turbo” drying, the electromechanical with Timer and the “Horizontal 90cm” models are excluded.

**SPARE PARTS:**

The spare parts catalogues of the dishwashers already produced with the “old” compartment are not updated. In any case, it is necessary to order the spare part no. indicated in the catalogue.

If, in case of intervention on appliances which feature the “new” compartment, the spare part received is the “old” compartment, it is necessary to cut the connection hose to the electric valve by a length of 23cm to avoid chokes or folds, as indicated in figure.

**Notes for interchangeability:**

The two compartments are functionally fully interchangeable.