


**Temperature fluctuation and/or alarm in freezer compartment
on CBFF electrovalve models**


DESCRIPTON:

The following document provides a troubleshooting to address problems of “Temperature fluctuation and/or Temperature alarm on Combi Bottom Partial Frost Free with electrovalve” (only with electronic control).
The following flow chart describes the check list to be verified by service technician.


TROUBLESHOOTING:

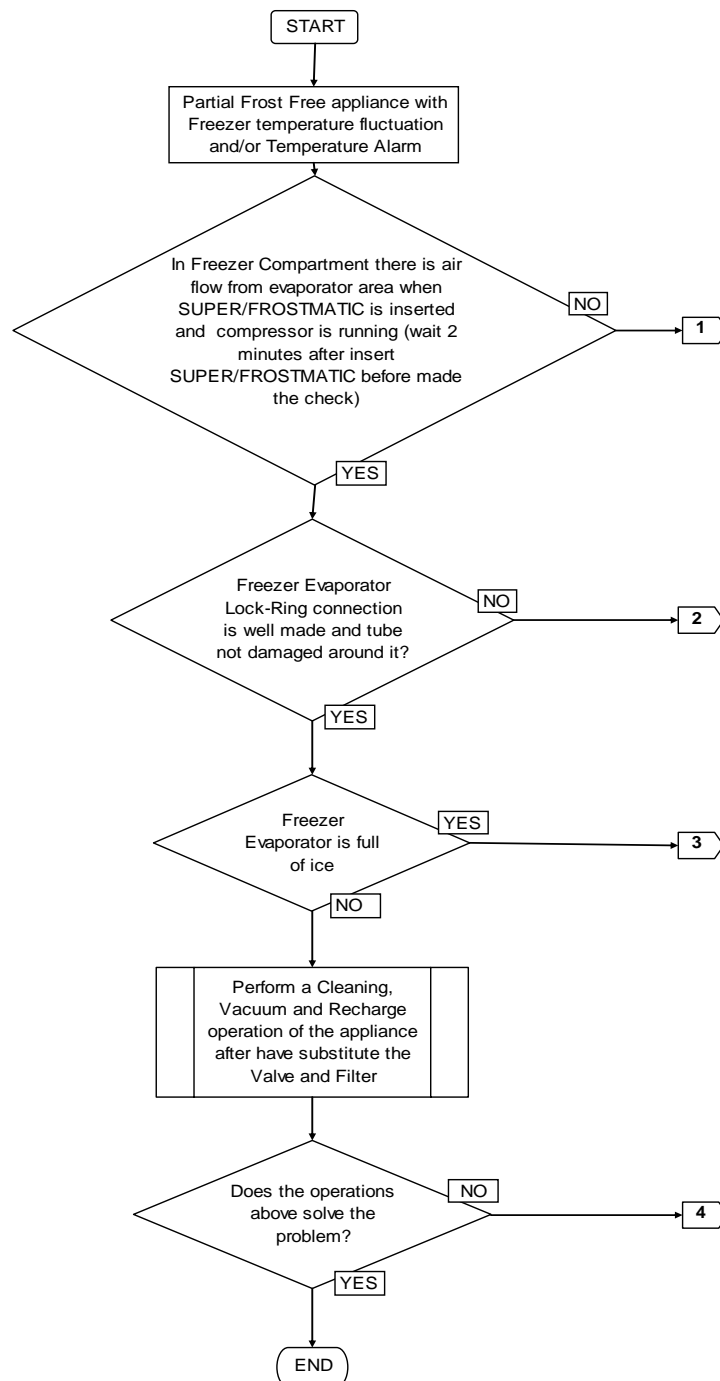


1. Check the Fan

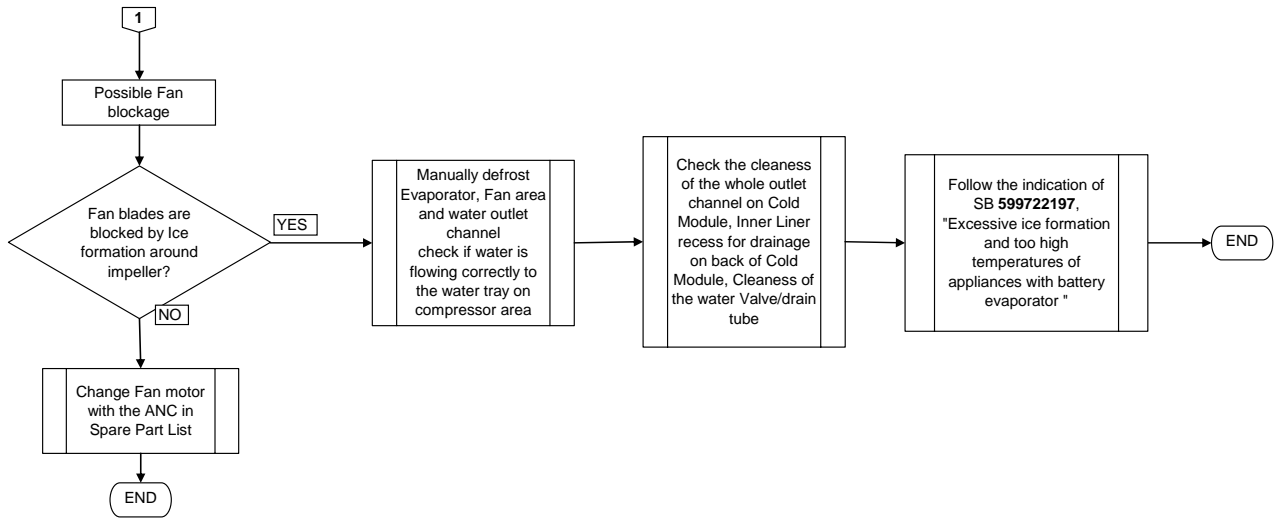


2. Check the freezer evaporator Lock-Ring Joints

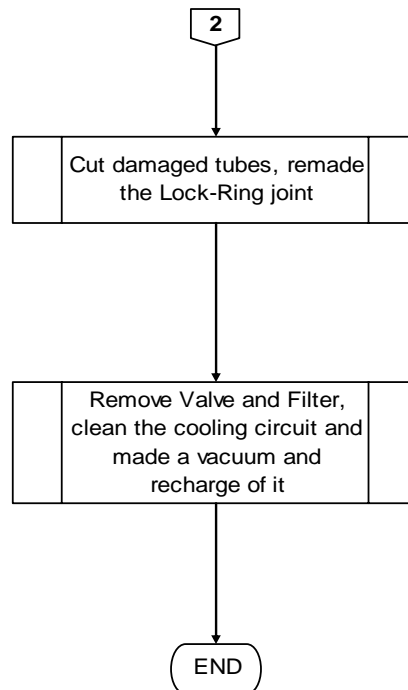

3. Check if there is ice formation

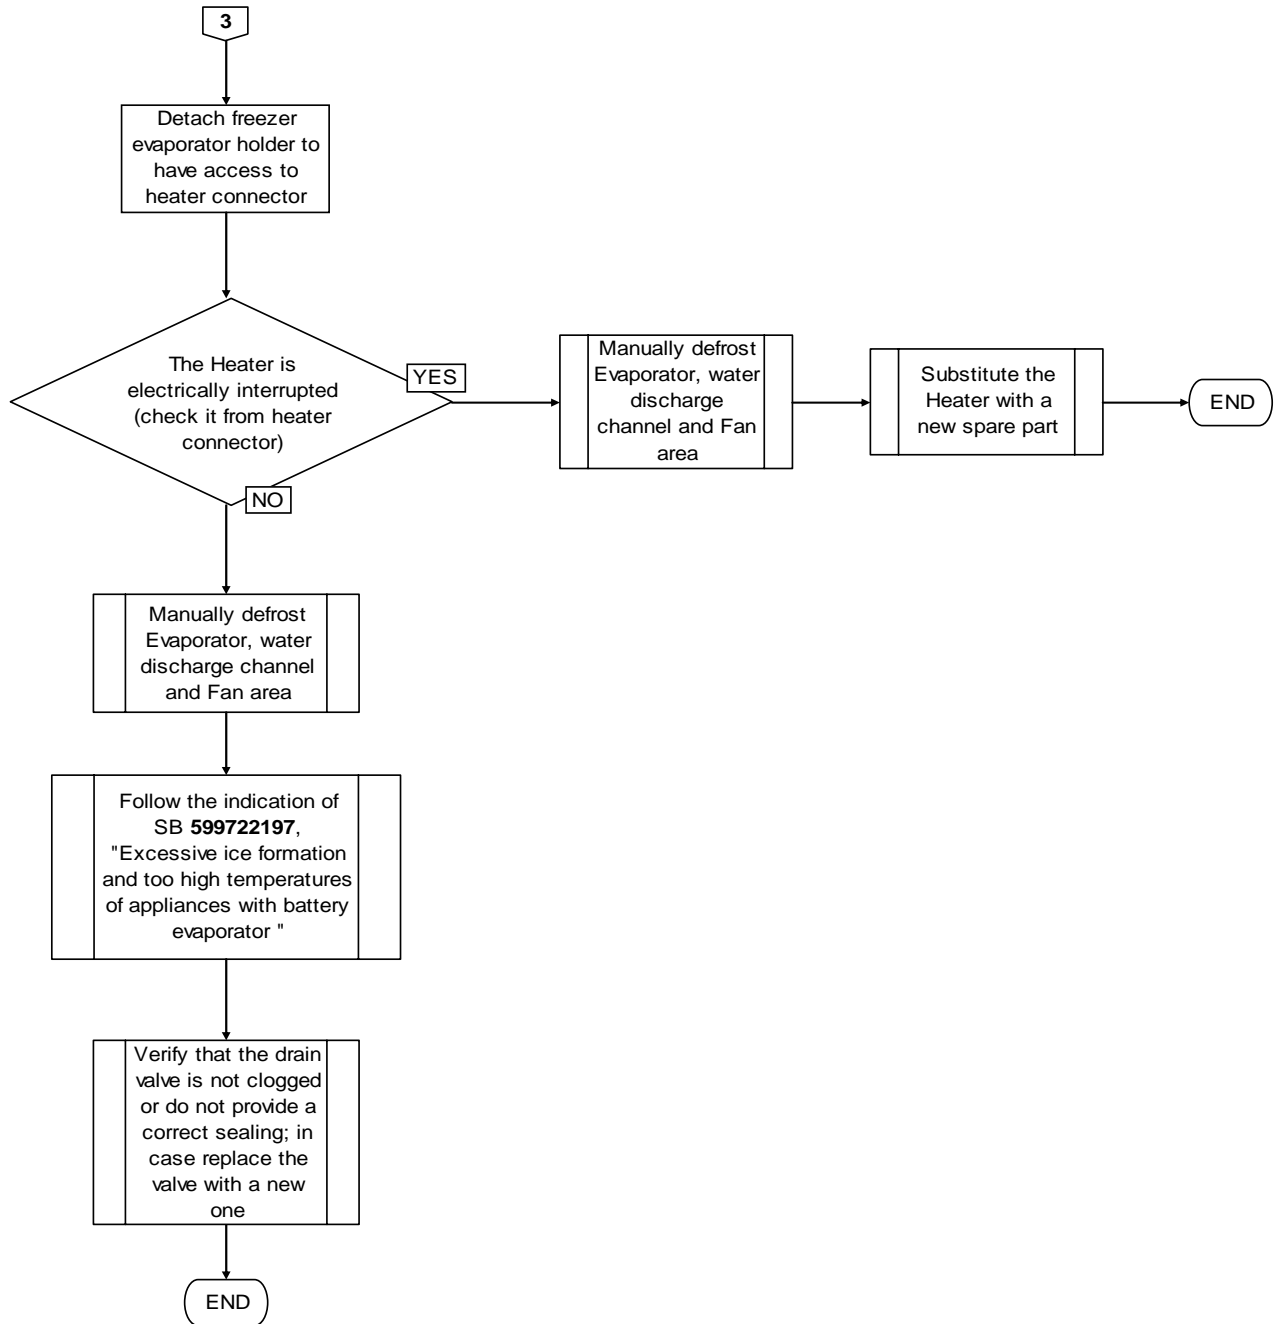

4. Check the Freezer and Fridge NTC

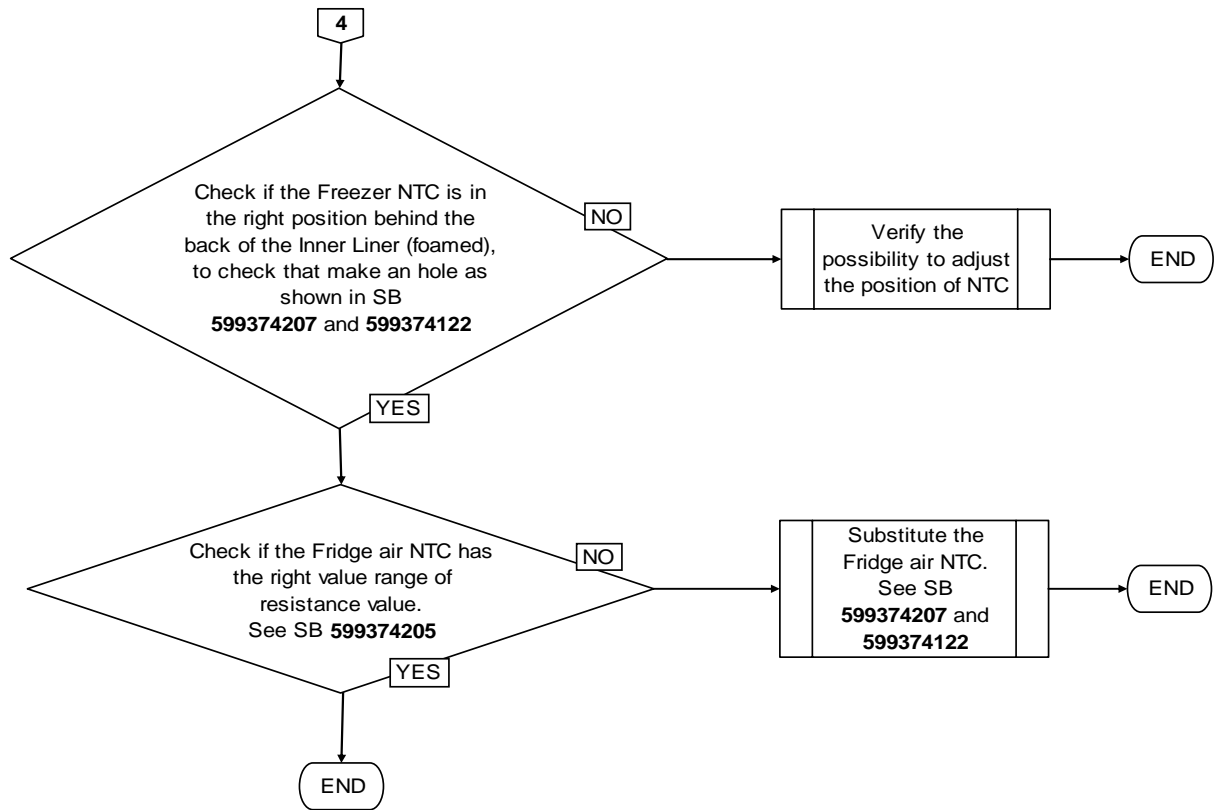

This document applies on following PNC:

PNC	TYPE (From Label)	Version
925 033 XXX	CBFF 3XX	Only with electronic controls