


ALARM INDICATION E90/E9E OR “NOT POSSIBLE” ON DISPLAY

DESCRIPTION:

In Tumble Dryer HP2C series 9N alarm code E90 may be displayed in normal operation mode. In diagnostic mode alarm code can change to E9E. This may occur in appliances with serial number up to 310xxxxx. In case of user interface board malfunction, message “Not possible” is displayed during drying cycle.



Normal operation mode

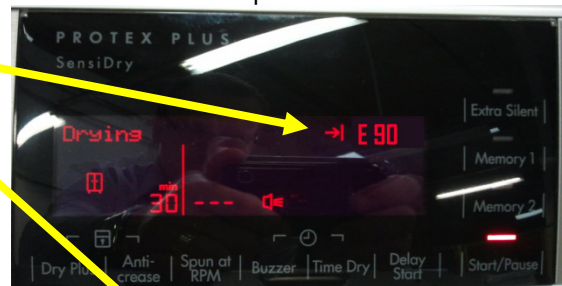

Diagnostic mode



SOLUTION:

Problem is caused by disturbances present on touch buttons. To solve it, user interface board has to be changed to new one (1366204384).

SPARE PART NUMBER:

Old spare part code	New spare part code	Description
1366204202	1366204384	User interface board, S.9N,HP2C
1366204228		
1366204368		

MODELS INVOLVED:

All Sahara HP2C tumble dryers with serial number up to 310xxxxx.

PNC	MODEL	BRAND
91609668900	T96585IH	AEG
91609669400	T96690IH	AEG Electrolux
91609669500	T96699IH	AEG Electrolux
91609669600	T96699IH	AEG Electrolux
91609669700	T96690IH	AEG Electrolux
91609674800	T96699IH	AEG Electrolux
91609679200	T96685IH	AEG Electrolux
91609679300	T96685IH	AEG Electrolux
91609679400	T96685IH	AEG Electrolux
91609679500	T96699IH	AEG Electrolux
91609679600	T96699IH	AEG Electrolux
91609679700	T96699IH	AEG Electrolux
91609681400	TWSL6E200	Electrolux
91609683200	QW9290	AEG Electrolux
91609684700	T96690IH	AEG
91609685500	T96699IH	AEG Electrolux
91609685600	T96699IH	AEG Electrolux
91609698500	T96699IH	AEG Electrolux
91609704200	T96685IH	AEG
91609704600	T96699IH	AEG
91609709600	T96699IHP	AEG
91609712200	T97689IH	AEG
91609712300	T97685IH	AEG
91609713600	QW9281	Husqvarna Electrolux
91609714900	TWSL6E201	Electrolux
91609715500	T97689IH	AEG
91609715600	T97685IH	AEG
91609715700	T97685IH	AEG
91609715800	T97689IH	AEG
91609715900	T97689IH	AEG
91609716500	T97689IH	AEG
91609716600	T97689IH	AEG
91609716800	T97680IH	AEG
91609717000	T97689IH	AEG
91609717100	T97689IH	AEG
91609719600	T97689IH	AEG
91609726400	T97688IH	AEG

REVISION:

Revision	Date	Description	Author	Approved by - on
01	10/2013	Added message problem	Krzysztof Łazowski	Marcin Bernacki – 03.10.2013
00	08/2013	Document Creation	Krzysztof Łazowski	Marcin Bernacki – 23.08.2013