

CE 04-DF, PISK2000, EK2000-LMC

Upgrade kit

Following a number of consumer complaints regarding cookers in LMC vehicles, where end-users sometimes refer to their cooking utensils getting black due to sooting, Dometic took corrective measures. It appeared that in some cases flaking of chrome particles from the used grids enhanced the sooting because they directly deposited on the burners thereby affecting the free flow of air and heat transfer negatively.

For end-users, who encountered previously mentioned symptoms, Dometic sets available various adaptation kits depending on the model installed from mid of March 2011 onwards (see page 2).


They can obtain this adaptation-kit free of charge at their dealer, but the adjustment should be carried out by dealers which are allowed to perform an EN1949 test. After this adjustment the complaints will belong to the past.

Dometic Group herewith hopes to have adequately taken the appropriate measures in order to ensure and safeguard the trust of your customers.


Please send your invoice and the warranty service order to Dometic GmbH, attn. to Mr. Schnell, In der Steinwiese 16, 57074 Siegen, Germany.
You will get 35,00 Euro net for the exchange.

Retrofit kit 1

Left version year of manufacture 2011/2012
chrome-plated grid without pins

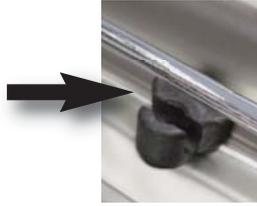


Right version year of manufacture 2011/2012
chrome-plated grid without pins

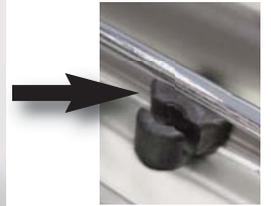


Retrofit kit 1, spare part number 407 1454-10/4
contains: right and left stainless steel grid, nozzles, sticker, manual

Retrofit kit 2

Left version year of manufacture 2013
chrome-plated grid with pins

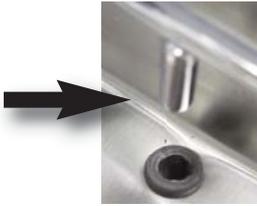


Right version year of manufacture 2013
chrome-plated grid with pins

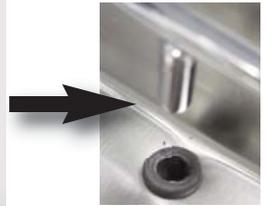

Retrofit kit 2, spare part number 407 1454-11/2
contains: right and left black enamelled grid, nozzles, sticker, manual

Retrofit kit 3

Left version year of manufacture 2014
black enamelled grid with pins

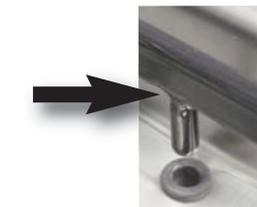

Right version year of manufacture 2014
black enamelled grid with pins



Retrofit kit 3, spare part number 407 1454-12/0
contains: nozzles, sticker, manual

