




### Contact between fan cover and hot air fan blades

#### DESCRIPTION:


During usage of convection fan, hot air may cause deformation of fan cover. As a result, fan blades may start hitting the fan cover.

#### SOLUTION:


1. For PNCs listed in Table 1, it is required to install only new fan blades,
2. For PNCs listed in Table 2, it is required to install new fan blades and new fan cover.

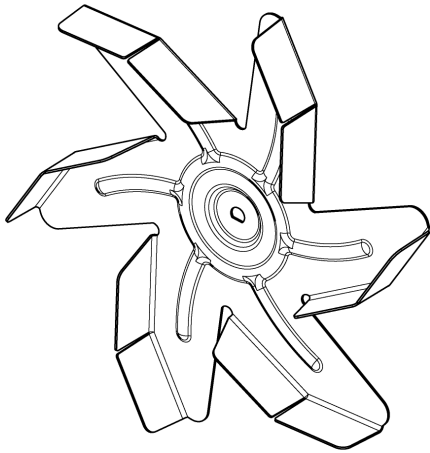


Old fan

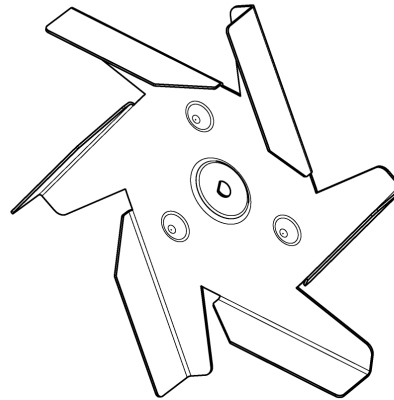

New fan

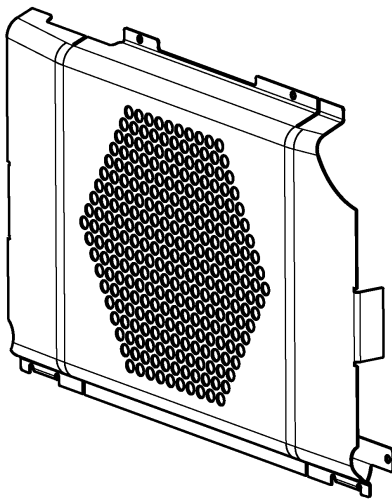

Old fan cover

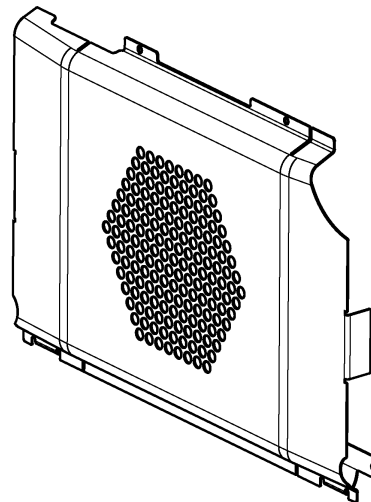

New fan cover

**SPARE PART NUMBER:**

Old fan	New fan
3152666214	3878453210

Old fan cover	New fan cover
3873143501	3873143519
3873143105	3873143113

**MODELS INVOLVED:**

Table 1 – list of PNCs, which require only new fan blades

PNC	MODEL	BRAND
94417154900	OV23 902-452-01	IKEA
94417154901	OV23 902-452-01	IKEA
94417154902	OV23 902-452-01	IKEA
94417154903	OV23 902-452-01	IKEA
94417155200	JLBIDO914X	John Lewis
94417155201	JLBIDO914X	John Lewis
94417155500	OV23 50284708	IKEA
94417155900	DE4013001M	AEG
94417156100	DC7013001M	AEG
94417156200	DC4013001M	AEG
94417156300	DE4043001B	AEG
94417156400	ZOD35511WK	Zanussi
94417156500	ZOD35511XK	Zanussi
94417156700	ZOD35712BK	Zanussi
94417156800	ZOD35712XK	Zanussi
94417157300	EOD5460AAK	Electrolux
94417157400	EOD5420AAX	Electrolux
94417158400	DC4013021M	AEG
94417158500	EOD5720AAK	Electrolux
94417158501	EOD5720AAK	Electrolux
94417158700	EOD5720AAX	Electrolux
94417158701	EOD5720AAX	Electrolux
94417158900	BIDO2SS	Neue

PNC	MODEL	BRAND
94417159300	ZOD35517XA	Zanussi
94417159500	DC7013021M	AEG
94417159700	DC7013101M	AEG
94417159900	DC7013101M	AEG
94417160000	LAM4602	Lamona
94417160200	DE401301DM	AEG
94417160400	DE401302DM	AEG
94417160500	ZOD35511DX	Zanussi
94417160600	ZOD35517DX	Zanussi
94417160700	ZOD55512XA	Zanussi
94417161000	DE401303DM	AEG
94417161100	ZOD35511XA	Zanussi
94417161700	DC4013001M	AEG
94417161800	JLBIDO915X	John Lewis
94417162000	EOD3460AAX	Electrolux
94417162100	EOD5460AAK	Electrolux
94417162200	EOD5420AAX	Electrolux
94417162800	EOD3460AAW	Electrolux
94417162900	EOD3460AAK	Electrolux
94417163100	EOD5720AAK	Electrolux
94417163300	EOD5720AAX	Electrolux
94417163400	ZDD35712XK	Zanussi

Table 2 – list of PNCs, which require new fan blades and new fan cover

<b>PNC</b>	<b>MODEL</b>	<b>BRAND</b>
94417155300	JLBIDU713X	John Lewis
94417155301	JLBIDU713X	John Lewis
94417155600	NC4013021M	AEG
94417155700	NC7013001M	AEG
94417155800	NC4013001M	AEG
94417156600	ZOE35511XK	Zanussi
94417156900	ZOF35712XK	Zanussi
94417157000	ZOF35511WK	Zanussi
94417158300	ZOF35511XK	Zanussi
94417158800	BUDO2SS	Neue
94417159100	LAM4402	Lamona
94417159200	ZOF35517XA	Zanussi
94417159400	NC7013021M	AEG
94417160100	LAM4403	Lamona
94417161200	ZOF35517DX	Zanussi
94417161400	ZOF35511XA	Zanussi
94417161500	NC4013011M	AEG
94417161600	NC4013001M	AEG
94417162500	EOU5420AAX	Electrolux
94417163200	EOU5460BAK	Electrolux

**REVISION:**

<b>Revision</b>	<b>Date</b>	<b>Description</b>	<b>Author</b>	<b>Approved by - on</b>
00	04/2017	Document Creation	Ewelina Fidor	Wojciech Rudnik 2017-04-26