


REMOVING THE EARTHING PIN FROM THE REAR CASING ASSEMBLY




From Serial Number 950 xxxxx in all the rear casing assemblies, a collar has been created in the area around the hub and the earthing pin has been eliminated. As a result of this:

• the relevant wiring is removed and the plastic pulley is used.

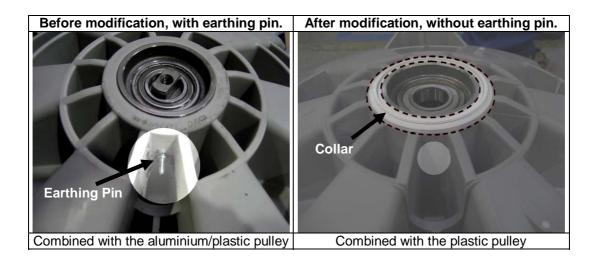

SPARE PARTS CODES:

The rear casing assembly, complete with collar and earthing pin, is supplied as a spare part and can be used on all appliances, as shown in the diagram provided on the table in the paragraph "service information".

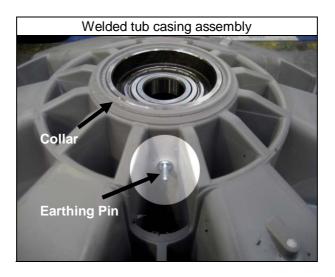

EN Publication number 599 72 70-45	Rev. 00	02/2009	dmm
------------------------------------	---------	---------	-----

MODELS CONCERNED:

In production the models concerned will have a new ELC (see description of the serial number).

- Please check that the ELC corresponds to the spare parts list!
- Fitting the aluminium pulley is strictly prohibited in new appliances produced starting from Serial Number 950 xxxxx included, batches with ELC 00.

SERIAL NUMBER

ELC – last two figures after the PNC **YEAR** last figure of the year of production **WEEK** of production

	ELC
I Electrolux	
Mod. XXX XXXXXX Type XXXXXXXX Prod.No. XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX	
Ser.No. XXX xxxxx	
YEAR WER	ΞK

SERVICE INFORMATION

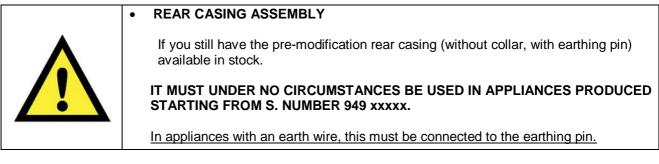


Table of washing unit/pulley combinations and production date

Production Appliances	Unit without collar and with earthing pin	Unit with collar and with earthing pin	Aluminium pulley	Plastic pulley
Before or with Serial number 949 xxxxx		O OK		
After or with Serial number 950 xxxxx				



PULLEY If the appliance is fitted with the rear casing assembly without earthing pin.

ONLY PLASTIC PULLEYS CAN BE USED

AND USE OF ALUMINIUM PULLEYS IS STRICTLY PROHIBITED.