




Tub - door gasket deformation or damage. Upper basket rail collision with tub – door gasket.

DESCRIPTION:

Upper basket rail collides with door – tub gasket. Gasket deforms or is damaged. Gasket can get detached from tub. Problem can occur in all Domodossola dishwashers with serial number up to 702xxxxx.

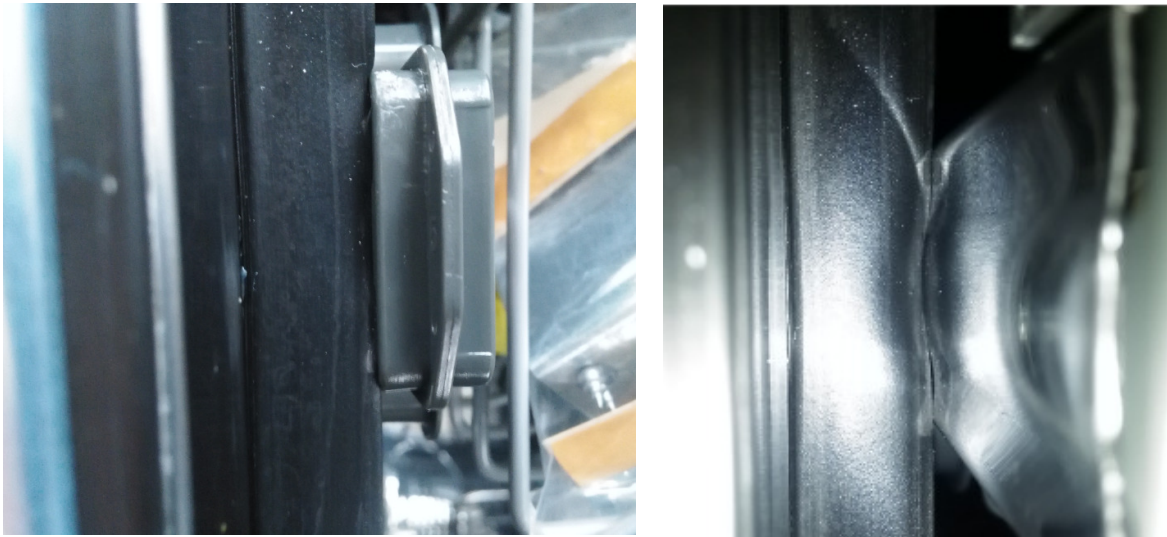

Rail collision with gasket.

SOLUTION:

Change upper basket rails and tub–door gasket. New upper basket rail has improved shape to avoid gasket damage.

Spare part number	Description
140101683021	Rail, Upper basket
1171265232	Gasket, outer, 45cm
1524445010	Gasket, outer, 60cm



New rails.

MODELS INVOLVED:

All Domodossola dishwashers with serial number up to 702xxxxx.

REVISION:

Revision	Date	Description	Author	Approved by - on
00	01/2017	Document Creation	Krzysztof Łazowski	Tomasz Kalbarczyk – 27.01.2017